

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

INDEX No. HES 217 COR No.4

History of original corner establishment:

Corner originally established by W.M.H. Woodward, Mineral Examiner, Sept. & Oct. 1917, Field Notes for that "Homestead Entry Survey No. 217, State: (Abbreviated) At intersect of line between Sec. 28/33 set C.C. and Cor. No. 4., A 25x10x12 ins stone 15" in the ground, mkd. (X) on top & CC on SE face and 4 HES 217 facing claim. From Which:

A pine, 8" dia., bears N56°E., 20 lks. mkd. X CC 4 HES 217 BT

A pine, 12" dia., bears N20°E., 16 lks. mkd. X CC 4 HES 217 BT

In 1976 R.D. Bagett PLS 598 found this corner and reestablished on the section line between sec. 28/33 as shown on Map of Survey No. 398 of the Grant County Survey Records. The CORNER RESTORATION sheet referenced to that Map States: At corner point: Set a 5/8" x30" iron pin 26" in the ground, from which: The original BT: A 14" pine snag bears N18°E, 12 ft.

A 14" fir bears S.31°W., 10.8 ft., mkd. HES4CSBT

A 14" fir bears N.16°W., 23.8 ft., mkd. HES4CSBT

Description of corner evidence found:

Found a 5/8" iron pin with 2" above the ground.

Found Bearing Tree as established by PLS 598

as shown on CORNER RESTORATION sheet as referenced to Map of Survey No. 398, of the County Survey Records.

Found a 16" Fir, scribed HES4CS BT

Bears N16°W., 23.8 ft. from the pin.

Accepted the iron pin as the corner, as re-established and shown on CORNER RESTORATION sheet and Map of Survey No. 398 of the Grant County Survey Records.

Corner is established on the Section line between sec.

28/33 approx. 3.5 ft. west from the original corner

by PLS 598. Remonumented the pin as shown below.

Description of monument and accessories | established to perpetuate the original location of this corner:

Set 2-1/2"x30" aluminum pipe with 3-1/2" aluminum cap, stamped as shown on the DIAGRAM, SET 26" in the ground.



From Which:

A Pine 8" dia., Bears N74°W., 4.0 ft., scribed: HES 217 COR NO 4 BT

The 16" Fir as established by PLS 598 is used as the other accessorie.

Measurements to trees taken with a metal tape and magnetic compass, with Declination set off 20 deg. East.

Nailed a brass washer stamped RLS 848 on blaze above BT scribe, Bearing Tree Sign above blaze, and warning sign on back of the new tree. Painted a 6" red band at breast ht. around each tree. Set steel fence posts with warning & Boundary Signs, NW & SE on property line approx. 5 ft. from the Corner.

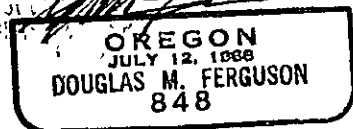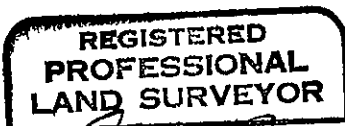

This work is performed by:
Douglas M. Ferguson RLS 848
Mt. Vernon Oregon.
On: April 2, 1987
Refer to Map of Survey No. 990

Office of.....*Sumner*..... County of.....*Grant*.....
State of.....*Oregon*....., I hereby certify that the within instrument was filed in this office
for record on the.....*29*..... day of.....*May*....., 19.....*87*.....
.....*Robert D. Baggett*..... by.....
(COUNTY OFFICIAL) (DEPUTY)