


CORNER RESTORATION

SW Cor.
CORNER Sec. 19 TWP 15S RANGE 32E
ORIGINAL SURVEY BY: Bamford Robb
CONTRACT NUMBER: 357
CONTRACT DATE: July 2, 1880

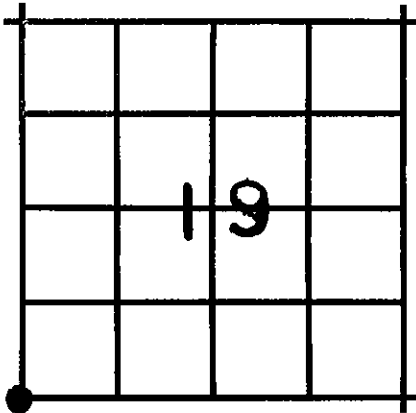


ORIGINAL DESCRIPTION:

North between Sections 25 and 30.
80.00 set post on bald ridge for cor. to Secs. 24, 25, 19 and 30 with pits
and mound as per instructions.

RECEIVED AND
FILED

RESTORATION BY, STAMP AND DATE.

R. D. Bagett
W. Gentis

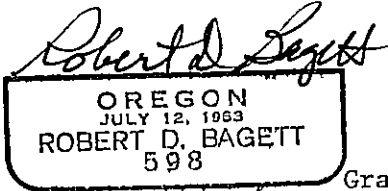

DEC 20 1976
John Liveira
JOHN LIVEIRA, County Clerk
By _____ Deputy,

May 17, 1976 Grant County Surveyor

EVIDENCE FOUND:

No evidence of the original section corner was found. I establish the section corner on the range line at single proportionate distance between the nearest found corners, namely the SW corner of Sec. 30 and the W 1/4 corner of Sec. 19.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set a 1 1/2"x30" iron pipe 15" in the ground MONUMENT MARKED
with brass cap marked as shown, from which I scribe
NEW BEARING TREES:

A 44" pine bears N. 63° E., 160.0 ft. mkd. T15SR32ES19CSBT.
An 11" pine bears S. 63° W., 58.7 ft. mkd. T15SR31ES25CSBT.
a 14" pine bears N. 58° W., 43.4 ft. mkd. T15SR31ES24CSBT.

I surrounded the pipe with a mound of stone to top of cap.
I used a compass with 20° East variation and a steel tape,
measuring to the face of the bearing tree blaze.

