


CORNER RESTORATION

CORNER S 1/4 Cor.
Sec. 19 TWP 15S RANGE 32E

ORIGINAL SURVEY BY: Samuel Lackland

CONTRACT NUMBER: 384

CONTRACT DATE: May 29, 1881

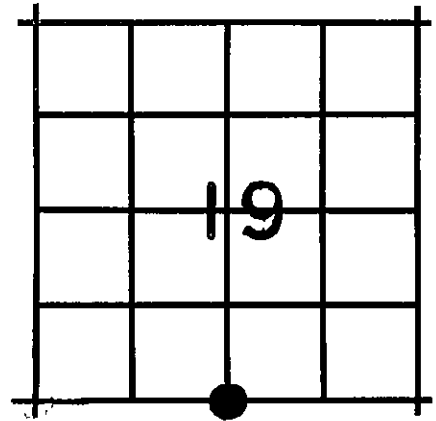

ORIGINAL DESCRIPTION:

39.70 set stone 16x10x6 in a mound of stone for 1/4 sec. cor., from which a pine 40" in diam. bears N. 36° E., 51 lks. dist.

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
W. Gentis

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

April 21, 1976

Grant County Surveyor

EVIDENCE FOUND:

Found original BT, a 36" down pine marked 1/4S BT. This tree has been pushed downhill about 60 ft. from it's original position in an old fence. This tree had wire fastened to it. I matched these wires to remains of fence and found stump hole where tree originally stood, at record bearing and dist. from this stump hole. I found a small mound of stone with a broken stone 16x6x4, no marks visible. I believe this to be the original cor. stone.


DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set 1 1/2"x30" iron pipe 24" in the ground with brass cap marked as shown. Buried original stone East and alongside, from which I scribe NEW BT's. **MONUMENT MARKED**

A 6" red fir bears S. 12° E. 12.6 ft. dist. mkd. 1/4S30CSBT
A 6" pine bears N. 72° W., 17.6 ft. dist. mkd. 1/4S19CSBT

Used compass with 20° E. variation and steel tape, measuring to face of BT blaze.

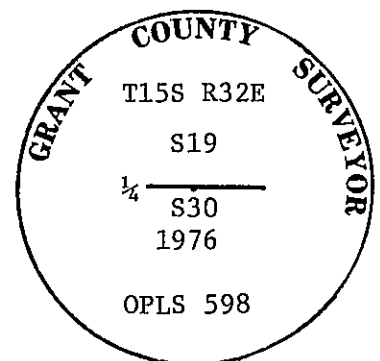

RECEIVED AND
FILED

John Liveira
DEC 20 1976
JOHN LIVEIRA, County Clerk

By _____ Deputy