


CORNER RESTORATION

CORNER N¼ Cor.
Sec. 29 TWP 15S RANGE 32E
ORIGINAL SURVEY BY: Samuel Lackland
CONTRACT NUMBER: 384
CONTRACT DATE: March 29, 1881

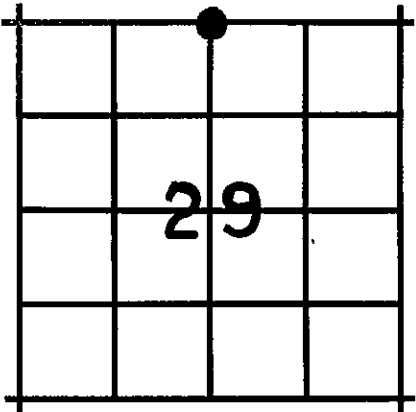


ORIGINAL DESCRIPTION:

39.84 set stone 16x11x6 in mound of stone for ¼ Sec. cor. from which
a pine 36" in diam. brs. S. 78° W., 50 lks. dist.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
W. Gentis



Robert D. Bagett



April 21, 1976

Grant County Surveyor

EVIDENCE FOUND:


At the corner point I found no evidence of original corner. However, I did
find a 1½"x48" iron pipe set 36" in the ground in a mound of stone. I accept
this position as it is in harmonious relationship to other found corners in
the area.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set 1½"x30" iron pipe 28" in the
ground with brass cap marked as shown. NEW BT's:
A 10" in diam. pine brs. S. 48° W., 75.7 ft. dist. mkd
¼S29CSBT
An 18" in diam. pine brs. N. 24° W., 72.7 ft. dist. mkd.
¼S20CSBT

I used a compass with 20° East variation and a steel tape
measuring to face of BT blaze.

MONUMENT MARKED

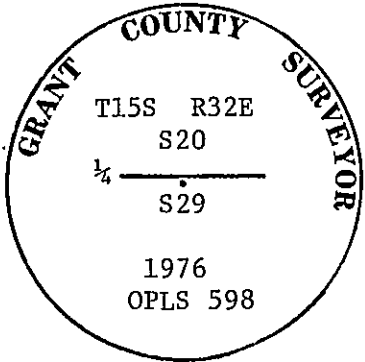

RECEIVED AND
FILED

DEC 20 1976
John Liveira
JOHN LIVEIRA, County Clerk

By _____ Deputy