


CORNER RESTORATION

N.1/4 Cor.
CORNER Sec. 34 TWP 15 S., RANGE 32 E.

ORIGINAL SURVEY BY: Samuel W. Lackland

CONTRACT NUMBER: 384

CONTRACT DATE: Mar. 29, 1881

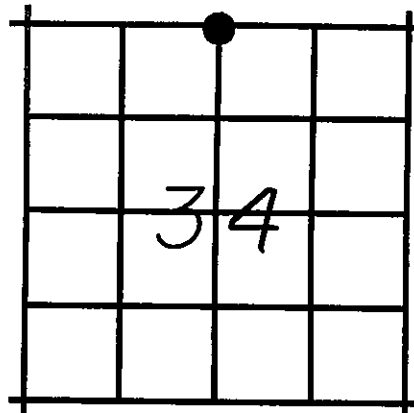


ORIGINAL DESCRIPTION:

East on a Random line between Secs. 27 & 34
40.00 Set temporary 1/4 Sec. Cor.
79.82 Intersect 24 lks. S. of Cor to Sec. 26, 27, 34 & 35 from which I run S. 89° 50" W.
on a true line between Sec. 27 & 34.
19.69 Pine 36 in. diam.
39.91 Set stone 15 x 6 x 4 in mound of stone for 1/4 Sec. Cor.
42.60 Pine 28 in. diam.

RESTORATION BY, STAMP AND DATE:

R. D. BAGETT
W. GENTIS



Robert D. Bagett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

FEB. 1976

GRANT COUNTY SURVEYOR.

EVIDENCE FOUND:

No evidence of original corner stone was found, corner stone was probably lost to logging operations. The 1/4 corner is not lost however, as I found the line tree as called for in the orig. notes at 42.60 chs. The line tree is a dead & down 36" pine, uprooted and downhill from the hole in the ground where it once stood. I established the 1/4 cor. on line between the tree hole and the fd. NE cor of Sec. 34 at record distance (177.54 feet from the line tree hole).

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set 1 1/2" x 30" iron pipe 24" in the ground with brass cap marked as shown.
from which I scribe new BEARING TREES:

A 10" pine bears S. 58° W., 42.0 ft. mkd 1/4 S34 CSBT


A 12" pine bears N. 60° W., 79.4 ft. mkd 1/4 S27 CSBT

The point at which the line tree once stood bears
S. 89° 40' 52" W., 177.54 ft.

Surrounded pipe with a mound of stone.

I used compass with 20° E. variation and a steel tape, measuring to the face of the BT blaze.

MONUMENT MARKED

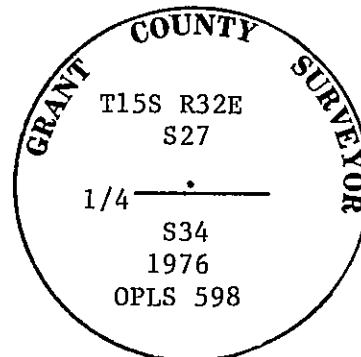

RECEIVED AND
FILED

NOV 29 1976

See Map of Survey No. 398

JOHN LIVEIRA, County Clerk
Darlene Lemon
By Deputy