

CORNER RESTORATION


W. 1/4 Cor.
CORNER Sec. 34 TWP 15 S., RANGE 32 E.

ORIGINAL SURVEY BY: Samuel W. Lackland

CONTRACT NUMBER: 384

CONTRACT DATE: Mar. 29, 1881

RETRACEMENT: W.M.H. Woodward
H.E.S. No. 217
Feb. 24, 1917

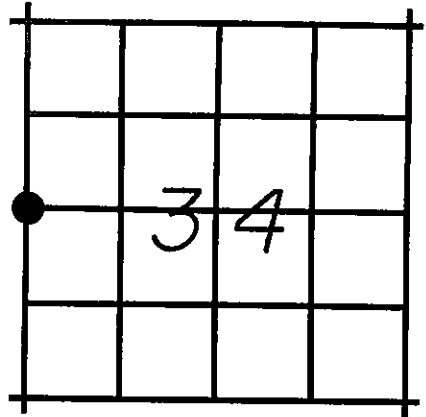


ORIGINAL DESCRIPTION:


40.00 Set stone 16 x 8 x 5 in mound of stone for 1/4 Sec. Cor.
From which: A Pine 36 in. in Diam. brs. N 54° W 88 lks. dist.
1917 RETRACEMENT by W.M.H. Woodward. 40.06 chs. fall 23 lks. West of 1/4 Cor. between Secs. 33 and 34, which is an unmarked stone set in a md. of stone, from which a pine, 12 ins. dia., brs. S. 84° E. 27 lks. dist., marked 1/4 S 34 on side facing corner. Growth rings indicate this tree was mkd. in 1881. No trace could be found of the B.T. described by the Surveyor General. I re-establish cor. by marking the orig. corner stone 1/4 on W. face and repair md. of stone. From which a 36 ins. Pine, brs. N 43° 30' W. 91 lks., mkd 1/4 S 33 BT (New BT)

RESTORATION BY, STAMP AND DATE:

R. D. BAGETT
W. GENTIS

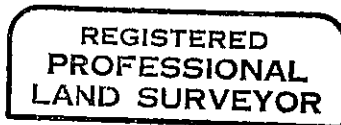

Robert D. Bagett



FEB. 1976

GRANT COUNTY SURVEYOR

EVIDENCE FOUND:

Found orig. corner stone 16" x 8" x 5" firmly set in md. of stone mkd 1/4 on West face.

From which:

A dead and down 36" pine brs. N. 36° W. 59 ft. possible B.T. tree is face down, could not see marks.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At corner point: Set 1 1/2" x 30" iron pipe 26" in ground
in md. of stone, with brass cap mkd as shown.

MONUMENT MARKED

I scribe NEW BTs:


A 6" Fir brs. N. 22° E. 6.2 ft. dist. mkd 1/4 S34 CSBT

A 20" Pine brs. N. 55° W. 23.1 ft. dist. mkd 1/4 S33 CSBT

Buried Orig. stone West and alongside pipe.

Used compass with 20° East Var. and steel tape measuring to face of BT blaze.

See Map of Survey No. 398

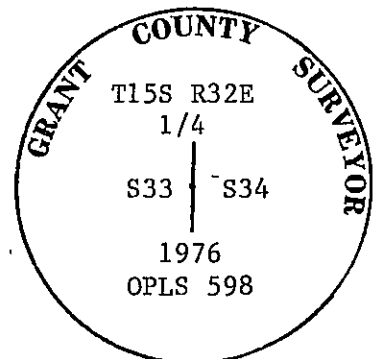

RECEIVED AND
FILED

NOV 29 1976

JOHN LIVEIRA, County Clerk
Darlene Simon
By _____ Deputy