

# CORNER RESTORATION


E. 1/4 Cor.  
CORNER Sec. 34 TWP 15 S. RANGE 32 E.

ORIGINAL SURVEY BY: Samuel W. Lackland

CONTRACT NUMBER: 384

CONTRACT DATE: Mar. 29, 1881

RESURVEY: Geo. F. Rigby  
Group No. 215  
April 19, 1939

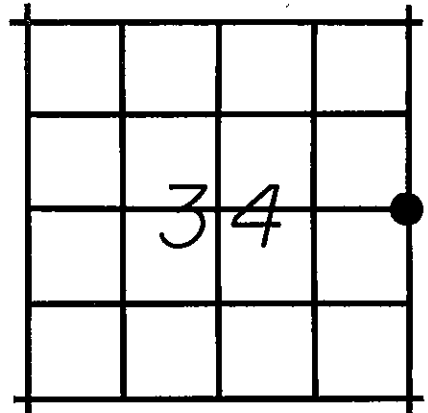

## ORIGINAL DESCRIPTION:

RESURVEY BY GEO. F. RIGBY

40.61 Set Iron post, 3 ft. long, 1 in. diam., 28 ins., in the ground, with original stone deposited at the base for 1/4 sec. cor., for Sec. 34 only, with brass cap mkd.

1/4 S34 | Old BT: A pine, 20 ins. diam., brs. S. 43° 00' W., 64 lks. dist.  
1939 | mkd 1/4 S34 BT  
New BT: A pine, 34 ins. diam., brs. N. 46° 00' W., 124 lks. dist.  
mkd 1/4 S34 BT

## RESTORATION BY, STAMP AND DATE:

R. D. BAGETT  
W. GENTIS

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Robert D. Bagett*

OREGON  
JULY 12, 1963  
ROBERT D. BAGETT  
598

FEB. 1976

GRANT COUNTY SURVEYOR

## EVIDENCE FOUND:

The GLO brass cap and the orig. 1/4 cor stone were not found. Construction of a logging road has destroyed both monuments. I establish the 1/4 corner at Rigbys record distance from his monument found at the West 1/4 corner of Sec. 35 and on line between the W1/4 cor. Sec. 35 and the Northeast corner of Sec. 34. Namely N. 0° 10' 38" E., 40.26 ft. This position agrees with the orig. B.T. (See below.)

## DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At corner point: Set 1 1/2" x 30" iron pipe 30' in the ground with brass cap mkd as shown.

From which the Original BT.

A 24" pine bears S. 43° W., 42.2 ft., with healed blaze.

No evidence of other bearing tree.

I scribe NEW BEARING TREE:


A 7" pine bears N. 38° W 18.2 ft. mkd 1/4 S34 CSBT.

Surround pipe with mound of stone.

Used compass with 20° E. var. and steel tape, measuring to face of BT blaze.

See Map of Survey No. 398

## MONUMENT MARKED

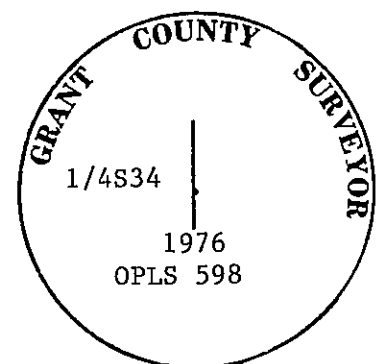

RECEIVED AND  
FILED

NOV 29 1976

JOHN LIVEIRA, County Clerk

By *Darlene Lemon* Deputy