


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:
Corner not previously established.

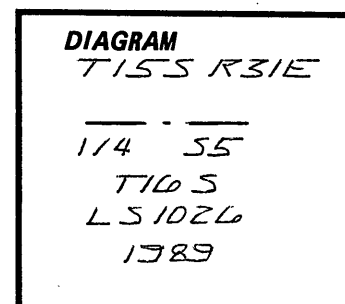

A-7
F.B. 9 P. 43-44

Description of corner evidence found:

None. Corner not previously established.

Description of monument and accessories | established to perpetuate the original location of this corner:

At position as determined by survey set a 2-1/2" O.D. x 30" long aluminum pipe 26" in ground with a 2-1/2" diameter aluminum cap marked as shown:
No stone available for mound.

Marked bearing tree:

A 17" Ponderosa Pine bears South 46° West, 100.3 ft., scribed "1/4S5BT". Painted a 6" red band and face blaze red. Nailed signs 54-9 and 54-3 to BT. Nailed a brass washer stamped "LS 1026" to face blaze of BT.


RM Set:

1"x24" long iron rod bears South 62° East, 31.41 ft., stamped "RM S5 LS1026 1989". Set a steel post 1 ft. past RM on line with cap with sign 54-9 facing RM. Set a steel fence post 2 ft. East of cap with signs 54-9 and 54-2. Bearings are by staff compass and declination is 19-1/2° East.


I hereby certify that the above corner monument was re-established as herein described on November 8, 1989.

Witnesses: Wes Heigh
Paul D. Woodworth

See C.S. #1123

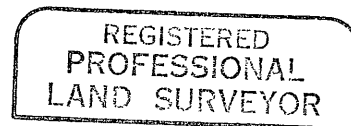

David B. Armstrong

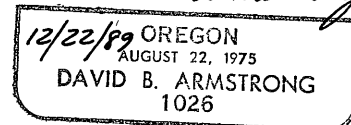

Office of Surveyor County of Groton
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 3 day of Feb, 1990
Robert D. Bayne by _____
(COUNTY OFFICIAL) (DEPUTY)