


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:
Corner not previously established.

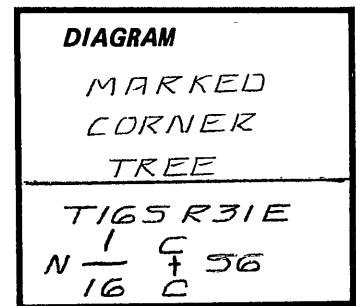

B-3
F.B. 6 P.38,39,64

Description of corner evidence found:
None. Corner not previously established.

Description of monument and accessories | established to perpetuate the
original location of this corner:

At position as determined by survey, fell in Southeast portion of 27" diameter Ponderosa Pine which I mark on West and East faces "CN1/16S6". Nail signs 54-9 on West and East faces. Paint 6" red band and face blazes red and nail brass washer stamped "LS1026" to East face.

Set Reference Monument:

Set a 2-1/2"O.D.x30" long aluminum pipe 22" in ground with a 2-1/2" diameter aluminum cap marked "RM S89°40'35"W 14.40 ← CN1/16 S6 LS1026 1989" Bears North 89°40'35" East, 14.40 feet from corner point. Set steel posts with signs 54-2 at 11-1/2 feet North and 9-1/2 feet East of corner.


Marked bearing trees:

A 13" Ponderosa Pine bears North 06° East, 48.6 ft., scribed "CN1/16S6BT"; a 13" Ponderosa Pine bears South 88° East, 31.5 ft., scribed "CN1/16S6BT". Painted a 6" red band and face blazes red. Nailed signs 54-9 and 54-3 to BT'S. Nailed a brass washer stamped "LS 1026" to face blazes of BT'S. Bearings are by staff compass and declination is 19-1/2° East.

I hereby certify that the above corner monument was re-established as herein described on October 13, 1989.

Witnesses: David B. Armstrong

See C.S. #1122

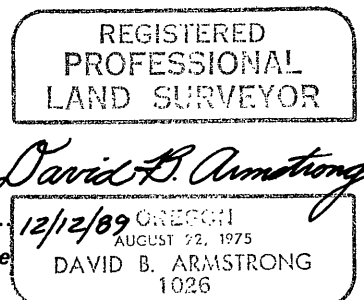

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 13 day of Feb, 1990
Robert D. Hays by _____
(COUNTY OFFICIAL) (DEPUTY)