


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner established by Samuel W. Lackland, deputy surveyor, under joint G.L.O. contract No. 357 dated July 2, 1880. Surveyor general's record states: North between Sections 15 and 16. Va. 18°30' East.

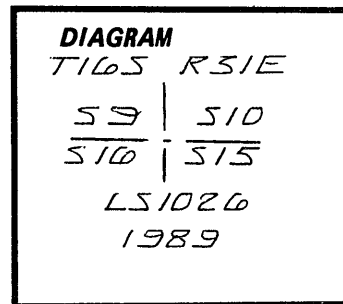

80.00 Set post for corner to Sections 9, 10, 15, and 16 with pits and mound as per instructions.

J - 13
F.B. 5 P. 63, 64

Description of corner evidence found:

At assumed corner location found long established and maintained North-South-East-West fence corner locally accepted as the section corner. Survey comparison of this location with the adjoining corners of the original survey indicates it is harmoniously located with these corners. Research revealed that the Oregon State Highway Department had tied this corner indicating it as the section corner on their map (drawing No. 5B-22-18, Oregon State Highway Department, right-of-way map, Bear Gulch section, John Day-Burns highway, Grant County, dated May, 1939). I checked their tie with the fence corner and the highway centerline as-built and found very close agreement, within 2 ft. I thereby accept the fence corner as a perpetuation of the original corner and so remonument for this survey.

Description of monument and accessories established to perpetuate the original location of this corner:

At position of accepted fence corner set a 2-1/2" O.D. x 30" long aluminum pipe 19" in ground to hardpan with a 2-1/2" diameter aluminum cap marked as shown: Raised a 3 ft. diameter stone mound to cap.



Reference Monuments Set:

A 1"x24" long iron rod bears North 02-1/2° West, 38.25 ft., stamped "RM S9 LS1026 1989"; a 1"x24" long iron rod bears North 84° East, 32.58 ft., stamped "RM S10 LS1026 1989"; a 1"x24" long iron rod bears South 01° East, 35.63 ft., stamped "RM S15 LS1026 1989"; a 1"x24" long iron rod bears South 83° West, 32.65 ft., stamped "RM S16 LS1026 1989". Set a steel post 1 ft. past RM's on line with cap with sign 54-9 facing RM. Set a steel post 5 ft. West of cap with sign 54-9. Bearings are by staff compass and declination is 19-1/2° East.

I hereby certify that the above corner monument was re-established as herein described on October 18, 1989.

Witnesses: Wes G. Heigh
Paul D. Woodworth

See C.S. #1124

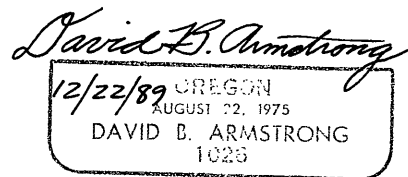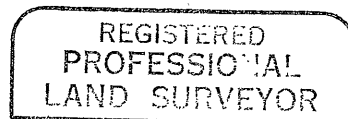

Office of.....Surveyor..... County of.....Grant.....
State of.....Oregon....., I hereby certify that the within instrument was filed in this office
for record on the.....13 day of.....Feb....., 19.....90.....
.....Robert D. Buzzett..... by.....
(COUNTY OFFICIAL) (DEPUTY)