


RECORD OF LAND CORNER MONUMENTATION

CORNER: S1/4 Cor. Sec. 17, Twp.9S., R.26E., W.M.

ORIGINAL SURVEY BY: Aaron F. York, U.S. Deputy Surveyor

CONTRACT NUMBER: 335

CONTRACT DATE: August 11, 1879

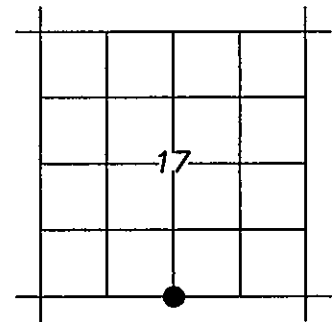

ORIGINAL G.L.O. DESCRIPTION: Set stone 13X11X9 for 1/4 Sec. Cor. Stone mound at Cor.

EVIDENCE FOUND: At the corner point, I found a portion of a broken stone marked with a 4. I did not find the remaining pieces of the marked stone. The portion I found was partially buried and when I attempted to remove it, it broke into several pieces. The position of the marked stone fits well with original GLO topo calls to the river and the foot of the hill. I accept the marked stone as the position of the original GLO 1/4 corner.

DESCRIPTION OF MONUMENT AND ACCESSORIES SET:

At the corner point, I set a 5/8" x 10" iron rod, driven to bedrock, with attached 2" aluminum cap marked as shown below. I built a 2 ft. mound of stone around the new monument.

FROM WHICH, I scribe the following bearing trees:

A juniper, 6" diam., bears N.57°E., 41.0 ft., marked 1/4 S17 BT.


A juniper, 6" diam., bears S.69°E., 64.1 ft., marked 1/4 S20 BT.

Measured distances to BT's using a steel tape measuring to a 50d nail driven into the side-center of the tree near the root crown. Placed BT tags on BT's.

ALSO FROM WHICH, I set the following reference points:

A 5/8"x15" iron pin, driven to bedrock, bears S.56°21'W., 14.04 ft., with attached yellow plastic cap marked BENCHMARK SURVEYING

A 5/8"x15" iron pin, driven to bedrock, bears N.50°03'W., 17.65 ft., with attached yellow plastic cap marked BENCHMARK SURVEYING

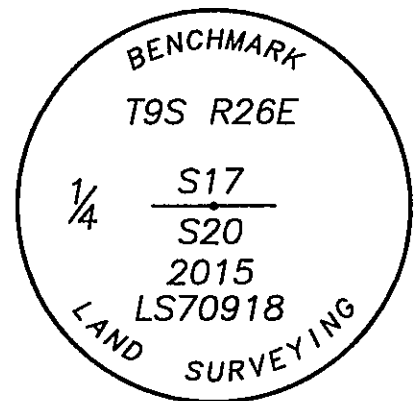

Bearings shown hereon to all accessories are based on a Record Map of Survey No. 2027.

RESTORATION BY:

Michael C. Springer, PLS
Benchmark Land Surveying
217 N. Canyon Blvd.
John Day, OR 97845

February 10, 2015

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

APR 24 2015

BY: 

REGISTERED
PROFESSIONAL
LAND SURVEYOR


OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2016