


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

A19

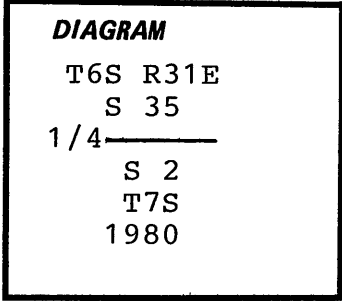

History of original corner establishment:
 Corner was originally established by Henry Meldrum, U.S. Deputy Surveyor, under Contract No. 380, dated March 19, 1881. Surveyor General records state: Set a pine post for 1/4 sec. cor. Pine 6 in. dia. bears N64°W 50lks. Fir 26" in. dia. bears S32°E 32lks. Corner remonumented by a BLM Cadastral Surveyor, John P. Lee, in 1980. His records state:

The 1/4 sec. cor. of secs. 2 and 35, on the N. bdy. of the Tp., monumented with a basalt stone, 10x12X23 ins., not of record, firmly set 13 ins. in the ground. no marks visible, from which the remains of the original bearing trees: A fir snag, 28 ins. diam. bears S. 30° E., 32 lks. dist., with partially chopped out blaze, no marks visible. (Record. S. 32° E.), A pine snag, 9 ins. diam., bears N. 64° W., 50 lks. dist., with scribe marks BT visible on partially opened blaze. At the corner point... Set an iron post 28 ins. long, 2 1/2 ins. diam., 22 ins. in the ground, with ~~XXXXXXXXXXXXXXXXXXXXXXXXXXXX~~ brass cap mkd. (as shown on corner diagram), from which new bearing trees... A fir. 15 ins. diam., bears S. 55° E., 63 lks. dist., mkd. 1/4 S2 BT, A fir. 15 ins., diam. bears N. 3 1/2° W., 17 1/2 lks. dist., mkd. 1/4 S35 BT. Deposit corner stone alongside iron post. See sheet two for additional history records, of corner maintenance performed by Gary Langlitz in July of 1982.

Description of corner evidence found:
 3 1/4" brass cap on 2 1/2" galvanized iron pipe in mound of earth and stone (protruding 8") from which:
 A steel fence post is 3.4 feet East of monument with 54-4 and 54-2 signs attached.
 A 7" fallen pine snag bears N 65° W - 33.6 feet, to the stump hole.
 A 17" douglas fir bears N 5° W - 11.4 feet, with healed blaze.
 A 16" douglas fir bears S 58 1/2° E - 41.8 feet, with partially healed blaze.
 A 24 1/2" ponderosa pine snag bears S 32° E - 21.1 feet.

original location of this corner:

Attached sign 54-9 to the existing steel fence post, and removed the 54-4 sign.

New bearing trees established:
 A 16" douglas fir bears N 82° E - 42.4 feet, scribed: 1/4 S 35 BT.
 A 14" douglas fir bears S 13° W - 27.4 feet, scribed: 1/4 S 2 BT.

New bearing trees have a brass washer stamped 'PLS 1106' nailed to the face of the blaze. Attached sign 54-3 & 54-9, painted face of blaze & 6" band around each bearing tree, red.

I hereby certify that the above corner monument was properly maintained to U.S.F.S. standards by me on August 10, 1993.

Compass declination 18° East.

Sheet 1 of 2 (continued on page 2)

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

William R. Wells

OREGON
 JULY 22, 1977
 WILLIAM R. WELLS
 1106

RENEWS 12-31-94

Office of Surveyor County of Grant
 State of Oregon, I hereby certify that the within instrument was filed in this office
 for record on the 4 day of Mar, 1994
Robert D. Baggett by _____
 (COUNTY OFFICIAL) (DEPUTY)