


CORNER RESTORATION

CORNER: C1/4 Sec.12 Twp. 13 S. Range 26 E., W.M.

ORIGINAL SURVEY BY: CORNER

SURVEY NUMBER: NOT PREVIOUSLY

CONTRACT DATE: ESTABLISHED

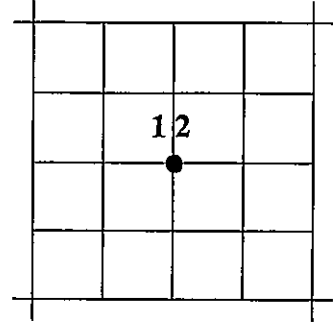

ORIGINAL G.L.O. DESCRIPTION: Corner not previously established

EVIDENCE FOUND: I searched for, but did not find the GLO stone at the S1/4 corner of Section 12. The Southwest Corner of Section 12 was set by Jack Watson in 2001. The corner is involved in an investigation by the Oregon State Board of Examiners for Engineering and Land Surveying (OSBEELS). I feel it would be inappropriate to accept this corner pending the outcome of the investigation by OSBEELS. Therefor, I established the C1/4 Corner of Section 12 at the intersection of an existing north-south fenceline and the east-west center line of Section 12.

See Land Partition Plat No. 2012-09, filed in the office of the Grant County Clerk

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

At the corner point I drove a 5/8"X30" iron pin flush with the ground with attached 2" aluminum cap marked as shown below.

FROM THE CORNER POINT I SET NEW REFERENCE POINTS:

- A 5/8"x30" iron pin bears N.80°25'E., 37.85 ft. with attached yellow plastic cap marked BENCHMARK SURVEYING
- A 5/8"x30" iron pin bears S.35°25'E., 36.73 ft. with attached yellow plastic cap marked BENCHMARK SURVEYING
- A 5/8"x30" iron pin bears S.65°18'W., 30.13 ft. with attached yellow plastic cap marked BENCHMARK SURVEYING
- A 5/8"x30" iron pin bears N.49°55'W., 27.91 ft. with attached yellow plastic cap marked BENCHMARK SURVEYING



(Bearings to reference points are based on Land Partition Plat No. 2012-09)

RESTORATION BY, STAMP AND DATE:


Michael C. Springer, PLS
July 30, 2012

RECEIVED AND FILED
GRANT COUNTY SURVEYOR

AUG 27, 2012

BY 

REGISTERED
PROFESSIONAL
LAND SURVEYOR


OREGON
JULY 9, 2002
MICHAEL C. SPRINGER
#70918

EXPIRES: 6/30/2014