


CORNER RESTORATION

CORNER: E1/4 COR. SEC. 24, TWP. 13 S., RANGE 26 E., W.M.

ORIGINAL SURVEY BY: W. H. Byars

CONTRACT NUMBER: 185

CONTRACT DATE: May 7, 1873

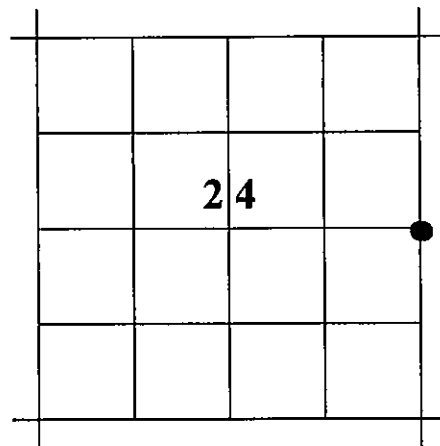

ORIGINAL DESCRIPTION: Set 1/4 Sec. Cor. A Stone 14x10x5

RESTORATION BY, STAMP AND DATE:

Michael C. Springer, PLS
Jason L. Hatfield, PLS

RECEIVED AND
FILED

JUNE 30, 2010

OFFICE OF COUNTY SURVEYOR

ATTEST: *Robert D. Byars*



EXPIRES: 6/30/2012

June 24, 2010 **SEE RECORD SURVEY NO. 1893**

EVIDENCE FOUND: We searched for, but did not find Byars' original monument. After a diligent search I determined this corner to be lost. I placed the new corner monument at the intersection of fences running North, South and West. The fences have been rebuilt in their current positions and I feel they best represent the location of this 1/4 Corner. The single proportion position for this corner would land very near the fence corner.

AT THE CORNER POINT: Set a 1½"x30" Galv. iron pipe with attached 2½" brass cap, 28" in the ground. We built a 2 foot mound of stone around the cap. Cap is marked as shown below.

FROM WHICH I MARK THE FOLLOWING BEARING TREES:

- A juniper, 8½ inch diam. bears N.79°E., 45.0 feet, marked "T13SR27E1/4S19 BT"
 - A juniper, 13 inch diam. bears S.58°W., 20.5 feet, marked "T13SR26E1/4S24 BT"
 - A juniper, 9½" diam. bears N.27°W., 20.9 feet, marked "T13SR26E1/4S24 BT"
- Attached BT tags to all trees

ALSO FROM WHICH I SET THE FOLLOWING REFERENCE POINT:

A 5/8"x30" iron pin bears S.48°36'E., 46.81 feet. with attached 1½" aluminum cap marked "BMLS SURVEY MARKER RP1 2010"

Used magnetic compass with 17° East variation and a steel tape to measure to a 60d nail driven into the side center of the root crown of the BT's. Used RTK GPS to measure to the reference point.

STATE PLANE COORDINATES: (3601 OR N)
Reference Datum: NAD83

Northing: 278,071.0 ft.
Easting: 8,455,175.9 ft.
Ellip Ht: 2,853.9 ft.

