


CORNER RESTORATION

Sec. 1
 CORNER SE 1/16 Cor. TWP T14S RANGE R32E

ORIGINAL SURVEY BY:

CONTRACT NUMBER:

CONTRACT DATE:

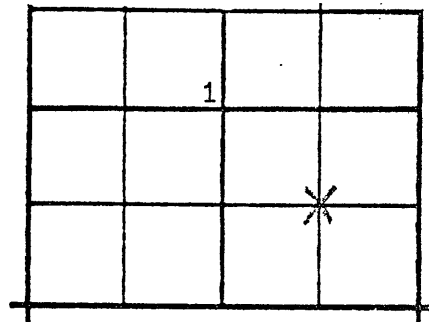

ORIGINAL DESCRIPTION:

No original corner set.

**RECEIVED AND
 FILED**

DEC 22 1976
John Liveira
 JOHN LIVEIRA, County Clerk


By _____ Deputy

RESTORATION BY, STAMP AND DATE:

(BEARING OBJECTS:

A PK spike nail in a power pole N10°E 87.0 ft.)

The Monument is 11' East of the center of the road, which runs N. and S.

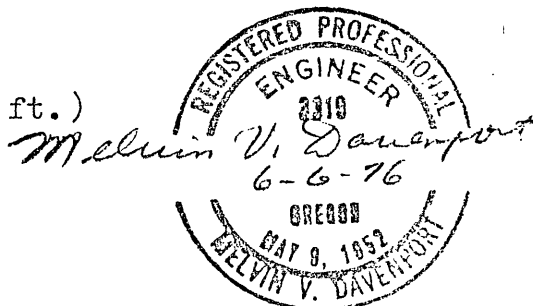

June 6, 1976

EVIDENCE FOUND:

No evidence.

This corner set by an intersection of two lines in Sec. 1, T14S R32E W.M. The lines are described as follows: The north and south line between the E. 1/16 corner on the center line and the E. 1/16 corner on the south line; The east and west line between the S. 1/16 corner on the center line and the S. 1/16 corner on the east line.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: Set a stem monument in cement 4" above the ground. The monument is set above a 1/2"x20" pipe set 6" below the ground level.

The brass stem monument is marked as shown.

From which I scribe NEW BEARING TREES:

A pine 9" diam., bears N56°E 41.4 ft., mkd. SE1/16 S1 BT.

A fir 10" diam., bears N30°W 102.2 ft., mkd. SE1/16 S1 BT.

(See above note for bearing objects).

I surrounded the corner with a mound of stone. I used a compass with a 20° east variation and steel tape measuring to face of BT blaze.

Complete and File with Office of the Grant County Surveyor, Grant County, Oregon, Courthouse, Canyon City, Oregon 97820

The trees were scribed and tagged by the G.C.S.

MONUMENT MARKED

