

CORNER RESTORATION


South $\frac{1}{4}$ corner

CORNER Sec. 26 TWP 15S RANGE 30E

ORIGINAL SURVEY BY: S. W. Lackland

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

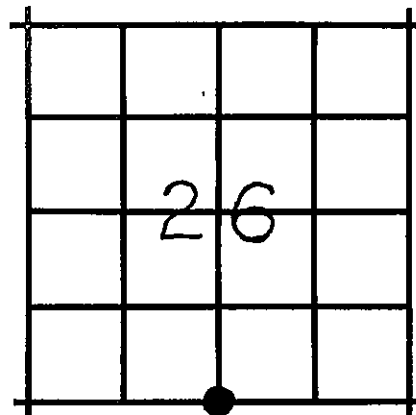

ORIGINAL DESCRIPTION:

West on true line between Secs. 26 and 35, 40.06 set post for $\frac{1}{4}$ sec. corner, from which:

A pine 24" in diam. brs. S. 35° E., 66 lks. dist.

A pine 36" in diam. brs. N. 48° W., 48 lks. dist.

RECEIVED AND FILED

JUN 24 1977

RESTORATION BY, STAMP AND DATE:

R. D. Bagett
W. Gentis

REGISTERED
PROFESSIONAL
LAND SURVEYOR

JOHN LIVEIRA, County Clerk

By *Betty Lowery* Deputy

Robert D. Bagett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

December, 1976

Grant County Surveyor

EVIDENCE FOUND:

At the corner point found $1\frac{1}{2}$ "x30" iron pin set by James Hanley (R.P.E. No. 2808) See map of Survey No. 449, from which 1 remaining BT:

A pine snag 30" in diam. brs. S. 35° E., 43.6 ft., faint scribing visible.

The other original BT was destroyed by road construction. I accept this position as it is at record bearing and distance from the one remaining BT.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point I set a $1\frac{1}{2}$ "x30" iron pipe 26" in the ground with brass cap marked as shown. Buried pin South and alongside iron pipe, from which I scribe NEW BT's:

A pine 9" in diam. brs. N. 25° E., 108.7 ft. mkd.

$\frac{1}{4}$ S26CSBT.

A pine 12" in diam. brs. S. 73° W., 24.0 ft. mkd.

$\frac{1}{4}$ S35CSBT.

Corner is approximately 40 ft. South of the center line of the Izee County Road. I used a compass with 20° East variation and steel tape, measuring to face of blaze on BT's.

MONUMENT MARKED

