

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**


**History of original corner establishment:**

Corner originally established by Herman D. Gradon under GLO contract number 499, dated March 11, 1884. Surveyor General record states:

Set a post 3 ft long 3 ins square 24 ins in ground for 1/4 sec cor, marked 1/4 on W face, from which:

A Fir 5 ins dia brs N30°W, 22 lks dist marked 1/4S BT  
 A Fir 7 ins dia brs S75°E, 14 lks dist marked 1/4S BT

Corner remonumented in September, 1979 by William L. Hanley. His notes state: Found a fir 20 ins diam with healed blaze for Section 24 BT. At the corner location as determined by the section 24 bearing tree found the rotted remains of a wood post to a depth of 20 ins. Set a 2 1/2" brass cap in 2" iron pipe 31" long 26" in ground with a surrounding rock mound. Brass cap marked (markings shown below). New bearing tree: A tamarack 18 ins diam bears N21°E, 56.0 ft dist mkd 1/4 S13 BT.

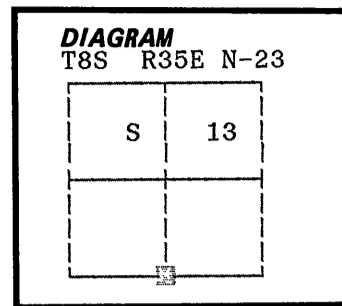


No record of subsequent monumentation found in Grant County survey records.

**Description of corner evidence found:**

Found a 2 inch brass cap on a 1 inch galvanized iron pipe in a mound of stone, with brass cap marked:

**Hanley Bearing Tree:**  
 Found a 20" diameter Tamarack N21°E, 56.0 feet, Live and vigorous with scribes visible.

**Original Bearing Tree:**  
 Found a 21" diameter White Fir S75°E, 14 lks, sickly, with blaze evident.

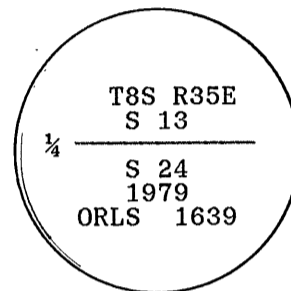

See map of survey dated September, 1987. *No. 1019*

**Description of monument and accessories | established to perpetuate the original location of this corner:**

From the above described brass cap monument:

**New BT:**  
 A 13 inch diameter Western Larch bears S5°W, 78.45 feet marked 1/4 S24 BT

Set a steel fencepost approximately 5 feet East.

I hereby certify that the above corner point was perpetuated as hereon described on August 4, 1987.



I used a steel tape and magnetic compass in the establishment of new accessories. I used 17° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

Office of Surveyor County of Grant  
 State of Oregon, I hereby certify that the within instrument was filed in this office for record on the 22 day of Oct, 1987  
Robert D. Bayett by \_\_\_\_\_  
 (COUNTY OFFICIAL) (DEPUTY)