

#70073

BOOK "1" PAGE 188


CORNER RESTORATION

 $\frac{1}{4}$ CORNER *3 1/2* TWP *11 S.* RANGE *32 EWM*

ORIGINAL SURVEY BY: S.W. Lackland

CONTRACT NUMBER: 357

CONTRACT DATE: July 2, 1880

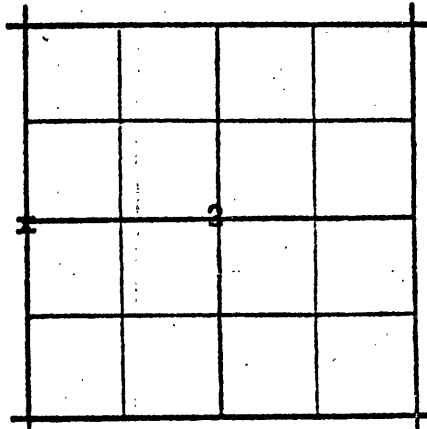

ORIGINAL DESCRIPTION:



Set stone $11 \times 11 \times 6$ in mound of stone for $\frac{1}{4}$ cor. from whichA pine 40 in. dia. bears N. 82° E. 50 lks. dist.A pine 10 in. dia. bears S. 87° W. 200 lks. dist.

RESTORATION BY, STAMP AND DATE:

Corner restored Oct. 14, 1972
by:**RALPH THOMPSON**

REGISTERED LAND SURVEYOR

P. O. BOX 1082 PENDLETON, ORE. 97801

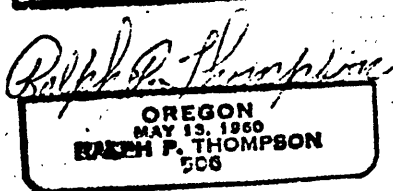

EVIDENCE FOUND:

14" pine stump at intersection of fences E-W-N. with scribing visible all other evidence apparently destroyed by cat road.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

Reversed bearing and distance from 14" pine stump & set a $1\frac{1}{2} \times 36$ " iron pipe with 2" brass cap marked as shown, 30 in. in ground and raised a mound of stones around it for $\frac{1}{4}$ cor. bet. sections 3 & 2. MONUMENT MARKED

From which new BT's

A 8" pine bears S. $86^{\circ} 30'$ E. 56.5 ft. dist. scribed $\frac{1}{4}$ S. BT.A 6" Juniper bears N. $5^{\circ} 40'$ W. 3.4 ft. dist. scribed $\frac{1}{4}$ S. BT.

All distances taken to face of blaze.


Used steel tape & magnetic compass with dec. = 21° E.

Checked angles with T-2 theodolite to verify bearings.

Complete and File with Office of the Grant

County Surveyor, Grant County, Oregon,

Courthouse, Canyon City, Oregon 97820

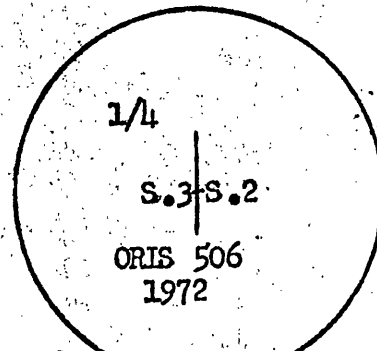

JAN 30 1973

Monument

Filed for record

ss. 70073

John L. Linn

by Betty Louway

County Clerk, Grant County, Ore.

Deputy