


CORNER RESTORATION

NE COR.
 CORNER Sec. 24 TWP 11 S. RANGE 29 E.

ORIGINAL SURVEY BY: William H. Byars

CONTRACT NUMBER: 185

CONTRACT DATE: May 7, 1873

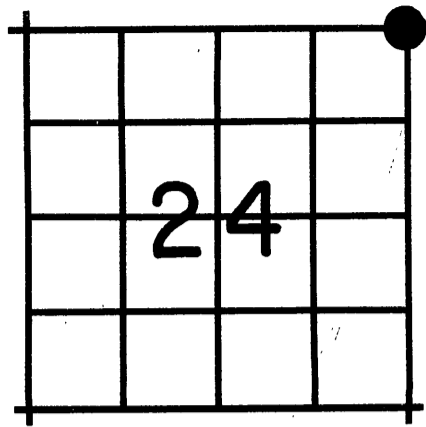

ORIGINAL DESCRIPTION: Set corner to sections 13, 18, 19, & 24, a stone 30"x10"x8".

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
 J.L. Watson
 K. Silva

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Robert D. Bagett
 OREGON
 JULY 12, 1963
 ROBERT D. BAGETT
 598

July 5, 1990

Grant County Surveyor

EVIDENCE FOUND: Found a basalt stone 30"x10"x7" in a mound of stones, marked with 3 notches one edge, other marks dim.

RECEIVED AND
 FILED

AUG 20 1990

John L. Watson
 GRANT COUNTY SURVEYOR

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: I set a 1½"x30" galv. iron pipe, 4" in the ground, with attached brass cap marked as shown. I placed the corner stone West and alongside the pipe in a mound of stones 4 ft. base to top of cap.

From which I ESTABLISHED NEW CORNER ACCESSORIES:

A low rock outcrop, bears N.81°E., 26.48 ft. marked "XBO".

A low rock outcrop, bears S.21°E., 66.20 ft. marked "XBO".

A 5/8"x30" iron pin, flush with the ground with attached alum. cap marked "GRANT COUNTY SURVEYOR RP1", bears S.29°W., 51.50 feet.

A 5/8"x30" iron pin, flush with the ground with attached alum. cap marked "GRANT COUNTY SURVEYOR RP2", bears N.69°W., 23.20 feet.

I used a magnetic compass with 20° E. var. and steel tape, in the establishment of new accessories.

MONUMENT MARKED

