


CORNER RESTORATION

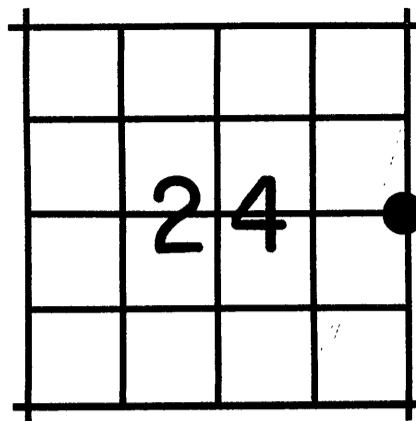

$E\frac{1}{4}$ COR.
 CORNER Sec.24 TWP 11 S. RANGE 29 E.

ORIGINAL SURVEY BY: William H. Byars

CONTRACT NUMBER: 185

CONTRACT DATE: May 7, 1873

ORIGINAL DESCRIPTION: Set a stone 14"x8"x2" and a mound of stone for the $\frac{1}{4}$ section corner.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
 J.L. Watson
 K. Silva

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Robert D. Bagett
 OREGON
 JULY 12, 1963
 ROBERT D. BAGETT
 598

July 5, 1990

Grant County Surveyor

EVIDENCE FOUND: Found a basalt stone 16"x7"x4" marked " $\frac{1}{4}$ " in a ring of stones.

RECEIVED AND
 FILED

AUG 20 1990

OFFICE OF COUNTY SURVEYOR
Robert D. Bagett
 Attest: *J. L. Watson*

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

Set a $1\frac{1}{2}$ "x30" galv. iron pipe, 24" in the ground, with attached brass cap marked as shown. Built mound of stone with a 3 ft. base to top of cap. I buried corner stone East and alongside the iron pipe, from which I TAKE NEW CORNER ACCESSORIES:

- A $\frac{5}{8}$ "x30" rebar, with aluminum cap marked "GRANT COUNTY SURVEYOR RP1", bears N.68°E., 34.25 feet.
- A $\frac{5}{8}$ "x30" rebar, with aluminum cap marked "GRANT COUNTY SURVEYOR RP2", bears S.40°E., 30.93 feet.
- A $\frac{5}{8}$ "x30" rebar, with aluminum cap marked "GRANT COUNTY SURVEYOR RP3", bears S.68°W., 29.13 feet.
- A $\frac{5}{8}$ "x30" rebar, with aluminum cap marked "GRANT COUNTY SURVEYOR RP4", bears N.40°W., 21.57 feet.

R.P.s are diametrically opposed.

Corner is 3 ft. north of E-W fenceline near west gate post.

I nailed BT tag to closest rockjack bears S.20°W., 3.2 feet.

I used a magnetic compass with 20° E. var. and steel tape, in the establishment of new accessories.

MONUMENT MARKED

