

# CERTIFIED RECORD OF LAND CORNER MONUMENTATION


A-1

**History of original corner establishment:**

STONE 14x12x10 IN MOUND

32" TAMARACK N15°E 43LKS  
 8" FIR N12°W 57LKS  
 8" FIR S81°E 30LKS  
 72" RED FIR S8°W 18LKS

AARON F. YORK, CONTRACT #309, Nov. 18, 1878

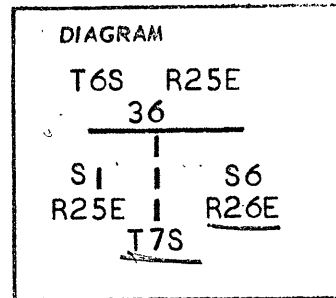

**Description of corner evidence found:**

Stone 12 X 9 X 7

Badly rotted stump, BRS S 9 1/2°W (Record S8°W), 15.3 Ft. Distance (Record 18 Lks) with no scribing remaining.  
 Badly rotted stump, BRS. N23°W (Record N12°W), 36.0 Ft. Distance (Record 57 Lks) with no scribing remaining.  
 Stump 27" Dia., BRS. N16 1/2°E (Record N15°E) 27.8 Ft. Distance (Record 43 Lks) with axe work but no scribing remaining.

**Description of monument and accessories I established to perpetuate the original location of this corner**

Set 32" X 2" flanged iron pipe with brass cap marked:

Douglas Fir, 14" Dia., BRS. S24 3/4°E, 14.9 Ft. Distance.

Marked: T6S R26E S6 BT

Larch, 15" Dia., BRS. S59 1/4°W, 31.4 Ft. Distance.

Marked: T6S R25E S1 BT

6' Iron Fence Post with "Attention" sign within 5' of Corner.

T6S R25E  
 S1 S6  
 R25E R26E  
 T7S  
 1979  
 PLS 346

All BTs have BT tag, new 13Ts have painted red stripe and brass washer stamped: PLS 346; nailed to lower blaze.

Buried original stone along iron pipe.

Office of \_\_\_\_\_ County Surveyor \_\_\_\_\_ County of \_\_\_\_\_ Grant \_\_\_\_\_  
 State of \_\_\_\_\_ Oregon \_\_\_\_\_, I hereby certify that the within Instrument was filed in this office  
 for record on the \_\_\_\_\_ day of \_\_\_\_\_ 1979  
 \_\_\_\_\_ by \_\_\_\_\_  
 (COUNTY OFFICIAL) (DEPUTY)

Corner  
 updated  
 Filed Dec 1982

Form R6-7100-57 (9/71)

REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR

OREGON  
 MAY 6, 1955  
 WAYNE O. HARRIS  
 346

GPO 796-333

A-1