


CORNER RESTORATION

CORNER N.W. cor. 25 TWP 7S RANGE 29 E

ORIGINAL SURVEY BY: Henry Meldrom

CONTRACT NUMBER: 380

CONTRACT DATE: March 1881

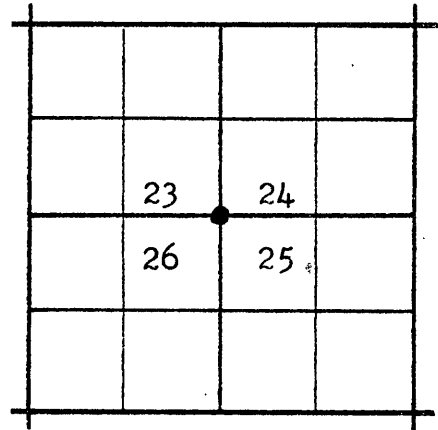

ORIGINAL DESCRIPTION:

80 chs. set a basalt stone 16" x 9" x 6" in a mound of stone for corner to sections 23, 24, 25, & 26 from which a pine 24" dia. bears N 59 W 42 lks. dist.

RESTORATION BY, STAMP AND DATE:

March. 8, 1971

REGISTERED
OREGON
LAND SURVEYOR

Douglas M. Ferguson

JULY 12, 1968
DOUGLAS M. FERGUSON
848


EVIDENCE FOUND:

Found original corner stone broken with 2 notches visible, in mound of stone from which a 24" pine, which is dead and down, bears N 59 W, 27 ft. dist., with old blaze and axe marks, scribing is burned out.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.
Set 1 1/2" x 36" galvanized iron pipe, with brass cap marked as shown, 6" in the ground, placed original stone north & alongside, deposited broken glass under base & raised a mound of stone around pipe, 4ft. base dia. to top of pipe.
From which a 8" dia. bull pine bears N 32 E, 72.3 ft. Marked T 7 S R 29 E S 24 BT.
A 9" bull pine bears S 33 E, 27.1 ft dist. marked T 7 S R 29 E S 25 BT.
A 6" bull pine bears S 24 W 35.0 ft. dist. marked X BT. A 7" bull pine bears N 71 W, 74.1 ft. dist. marked T 7 S R 29 E S 23 BT. Corner North & West Complete and File with Office of the Grantfence bears S 81 W County Surveyor, Grant County, Oregon, 40 ft. E Road bears south Courthouse, Canyon City, Oregon 97820 112 ft. All bearings mag. with 20 deg. set off

MONUMENT MARKED

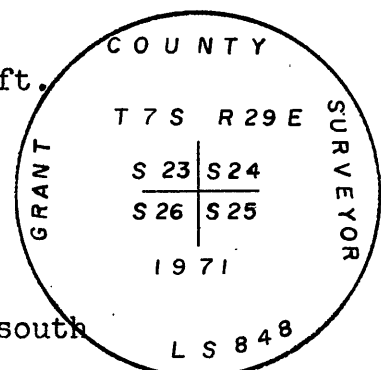

R-21