


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

1298

C17

History of original corner establishment:

Corner was originally established by Frank W. Campbell, U.S. Deputy Surveyor, under Contract No. 380, dated March 19, 1881. Surveyor General records state: Set a basalt stone 15X7X5 in. in a mound of stone for 1/4 sec. cor..

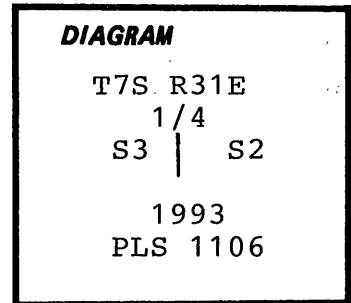

Description of corner evidence found:

None. Corner re-established by single proportionate measure between the recovered corner at the Northeast corner of section 3 and the recovered corner at the Southeast corner of Section 3.

Corner area was searched for 3 hours by professional land surveyor and for an additional 2 1/2 hours by 2 person crew when traversing through corner area and when corner point was established. An area with a radius of 150 feet around the calculated corner position was covered. There are very few stones of record size in the search area. No acceptable evidence of the corner was recovered.

Description of monument and accessories I established to perpetuate the original location of this corner:

At position determined by survey...

Set 2 1/2"X30" aluminum pipe with 2 1/2" aluminum cap 18" in the ground and surrounded with a mound of stone. Cap is marked as shown in corner diagram.

Set steel fence post 4.0 feet North of corner with sign 54-9 attached.

New accessories established:

A 2 1/2'X4'X8" out of ground basalt outcrop bears N60°E-128.2 feet, to the marks 'XBO' chiseled on top of outcrop.

A 3'X5'X1' out of ground basalt outcrop bears S70°E-181.1 feet, to the marks 'XBO' chiseled on West face.

A 18" juniper bears S2°W-255.1 feet, scribed: 1/4 S3 BT.

A 36" ponderosa pine bears N78°W-348.2 feet, scribed: 1/4 S3 BT.

New bearing trees have brass washer stamped 'PLS 1106' nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each bearing tree. Bearing objects have sign 54-3 anchored near markings, measured to X, and painted "XBO" markings red.

I hereby certify that the above corner monument was properly reestablished to U.S.F.S standards by me on August 27, 1993.

Compass declination 18° East.

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

William R. Wells

OREGON
 JULY 22, 1977
 WILLIAM R. WELLS
 1106

Office of Surveyor County of Grant
 State of Oregon I hereby certify that the within instrument was filed in this office RENEWS 12-31-94
 for record on the 4 day of June, 1994
Robert D. Baggett by _____
 (COUNTY OFFICIAL) (DEPUTY)