


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index No. J-17

History of original corner establishment:

This corner was originally established by Frank W. Campbell under Contract No. 521 dated January 8, 1885. The notes state that at the corner a 16" x 9" x 4" notched basalt stone was set 11 inches in the ground and a mound of stone was raised alongside.

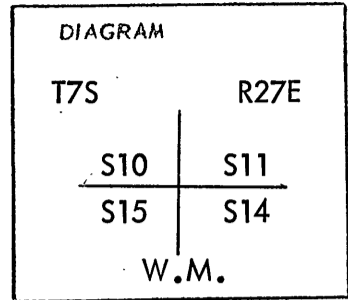

No record of subsequent remonumentation found in County Records .

Description of corner evidence found:

None. Corner was re-established by double proportion measure.

Description of monument and accessories established to perpetuate the original location of this corner

At the corner position a 2 inch by 30 inch iron pipe, with brass cap marked as shown, was set 4 inches in the ground and surrounded with a mound of stones to the cap .

Set steel fence post west of corner and attached signs 54-2 and 54-4.

Established 4 new BT's:

A 9½" juniper bears N 53° E, 141.4 feet scribed T7S R27E S 11 BT

A 7" juniper bears S 41° E, 113.7 feet scribed T7S R27E S 14 BT
(this is a school-marm tree 1 trunk 7" (scribed) 1 trunk 9½" on west)

A 12" juniper bears S 62½° W, 231.6 feet scribed T7S R27E S 15 BT

An 11½" juniper bears N 40° W, 115.7 feet scribed T7S R27E S 10 BT

New BT's have a lower blaze scribed BT with a brass washer stamped PLS 1106 nailed flush.

Attached signs 54-3 and 54-4 to all BT's and painted red ring around trees above upper blaze. Used steel tape and magnetic compass with 19½° east declination. Measured to center of Bts.


See map of survey .

This corner set September 19, 1979

Witnesses: D. Kaufman, PLS
G. Flowers, LSIT
B. English
B. Reynolds

REGISTERED PROFESSIONAL LAND SURVEYOR

<i>William R. Wells</i>
OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

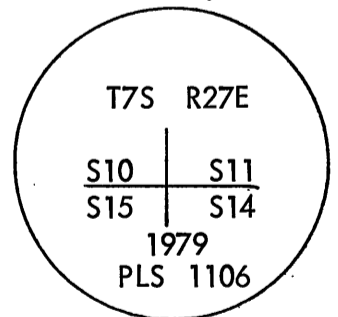

Office of County Surveyor County of Grant
State of Oregon, I hereby certify that the within Instrument was filed in this office
for record on the 15 day of Oct 1979
Robert D. Beggs by _____
(COUNTY OFFICIAL) (DEPUTY)