


**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

E19

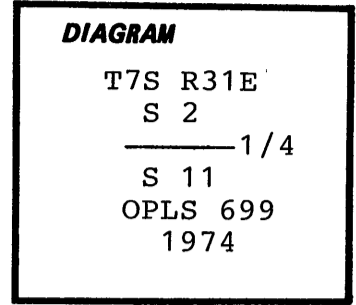

**History of original corner establishment:**

Corner was originally established by Frank W. Campbell, U.S. Deputy Surveyor, under Contract No. 380, dated March 19, 1881. Surveyor General records state: Set a pine post for 1/4 Sec. corner, from which: pine 40 in. dia. bears N54°E-60lks. dist., pine 30 in. dia. bears S24°E-197lks. dist.

Corner remonumented by Leland Myers, Oregon Professional Land Surveyor under contract with the U.S.F.S. dated 10/26/74. His record states: Found a small pile of small stones, but not the original corner post. Found a high stump, with all scribing visible to the North of the corner. The South BT is a very low stump with BT scribing on the stump. Set 2"X 14" galvanized pipe with 2 1/2" brass cap 8" in the ground to bedrock. Anchored the base with cement and mortared rock around the pipe 10" in diameter and 6" high. Surrounded monument with rock mound 8" high and 24" in diameter. Set a 4" X4"X6' redwood post 8" in ground and surrounded by dirt mound with some rock,

as guard post for the corner. Scalped bark and painted red band around new Bearing Trees and posted signs 54-3 with the following information:

High Stump	S54°W	39.6'	New BT's were scribed
Low Stump	N24°W	130.0'	in upper blaze; an in each lower
12" P. Pine	N84°E	80.5'	1/4 S11 blaze; BT, along
16" D. fir	S16°W	66.0'	1/4 S2 with a brass nail & washer stamped RLS 699

**Description of corner evidence found:**

2 1/2" brass cap on 2 1/2" galvanized iron pipe, protruding 5" from mound of stone & concrete, from which:  
A 38" rotten pine stump bears N 55° E - 39.7 feet with an open blaze and visible scribing.  
A 28" rotten pine stump bears S 20° E -129.7 feet, with visible scribing.  
A 18" ponderosa pine bears S 88° W - 80.2 feet, with a healed blaze.

A 17" ponderosa pine bears N 14° E - 66.1 feet, with a healed blaze. Wooden post lying on the ground near the corner.

**Description of monument and accessories established to perpetuate original location of this corner:**

Set steel fence post 3.3 feet West of corner with sign 54-2 & 54-9 attached.

**New bearing trees established:**

A 12" ponderosa pine bears S 43 1/2° E - 69.5 feet, scribed: 1/4 S11 BT.  
A 14" ponderosa pine bears N 47° W - 74.3 feet, scribed: 1/4 S2 BT.

New bearing trees have a brass washer stamped 'PLS 1106' nailed to face of blaze. Attached sign 54-3 & 54-9, painted face of blaze & a 6" red band around each bearing tree.

I hereby certify that the above corner monument was properly maintained to U.S.F.S standards by me on August 11, 1993.

Compass declination 18° East.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*William R. Wells*

OREGON  
JULY 22, 1977  
WILLIAM R. WELLS  
1106

RENEWS 12-31-94

Office of Surveyor County of Grant  
 State of Oregon, I hereby certify that the within instrument was filed in this office  
 for record on the 4 day of March, 1994  
Robert D. Ryzar by \_\_\_\_\_  
 (COUNTY OFFICIAL) (DEPUTY)