


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

1298

G21

History of original corner establishment:

Corner was originally established by Frank W. Campbell, U.S. Deputy Surveyor, under Contract No. 380, dated March 19, 1881. Surveyor General records state: Set a basalt stone 25X18X18 and raised mound of stone for 1/4 sec. cor..

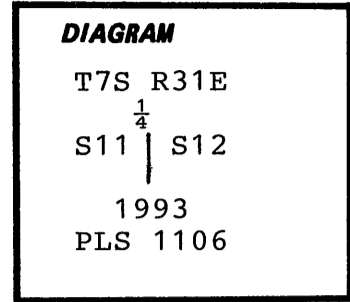

Description of corner evidence found:

A 25X18X18 inch stone at North side of a 3 foot diameter mound of small stones. Stone had been disturbed by previous searchers. No marks were found on the stone. Re-established the corner position in the center of the found stone mound.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 2 1/2" X 30" aluminum pipe with 2 1/2" aluminum cap, 8" in ground to solid basalt and surrounded with a mound of earth and stone. Cap marked as shown in corner diagram.

Set steel fence post 4.5 feet South of corner with 54-9 sign attached.

New bearing trees established:

- A 10" ponderosa pine bears N40°E- 50.8 feet, scribed: 1/4 S12 BT.
- A 15" juniper bears S56°E- 146.4 feet, scribed: 1/4 S12 BT.
- A 25 1/2" ponderosa pine bears S0 1/2°W- 45.7 feet, scribed: 1/4 S11 BT.
- A 10" ponderosa pine bears N50°W- 107.9 feet, scribed: 1/4 S11 BT.

All bearing trees have a brass washer stamped 'PLS 1106' nailed to the face of the blaze. Attached sign 54-3 & 54-9, painted face of blaze & 6" red band around each bearing tree.

I hereby certify that the above corner monument was properly re-established to U.S.F.S. standards by me on August 23, 1993.

Compass declination 18° East.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

RENEWS 12-31-94

Office of *Surveyor* County of *Grant*
 State of *Oregon* I hereby certify that the within instrument was filed in this office
 for record on the *4* day of *Mar*, 19*94*
Robert D. Bayett by _____
 (COUNTY OFFICIAL) (DEPUTY)