

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Index: C-15

Center quarter corner, Secs. 3, T.7S., R.32E., W.M. Township originally subdivided by Rufus Moore under Contract No. 382 dated March 23, 1881. This corner was not set at that time. A retracement survey was made by the BLM under assignment instructions dated 1967. Their record reads:	1	DIAGRAM	1
Point for the center 1/4 sec. cor. of sec. 3, at intersection with the E. and W. center line.	1	BLM brass cap	1
Set an iron post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, in a mound of stone, 3 1/2 ft. base, to top, with brass cap mkd. (diagram).	1	T7SR32E	1
from which	1	C1/4 S3	1
A fir, 10 ins. diam., bears S. 84 1/4°E., 86 1/2 lks. lks. dist., mkd. C1/4 S3 BT. (1968)	1	1968	1
A fir, 4 ins. diam., bears S. 50°W., 7 1/2 lks. dist., mkd. X BT. (1968)	1		1


Description of corner evidence found:

Found the corner monument as described from which:
 A 12" dbh bears S.84 1/4°W., 57.1' with healed blaze.
 A 5" dbh dead Douglas Fir bears S.50°W., 5.0' with visible scribe.


Description of monument and accessories I established to perpetuate the original location of this corner:

Set new bearing trees as follows:
 A 7" dbh Douglas Fir bears N.0 3/4°E., 24.8' scribed C1/4 S3 BT.
 A 7" dbh Douglas Fir bears N.28 1/4°W., 27.0' scribed C1/4 S3 BT.
 A 18" dbh Douglas Fir bears S.54°W., 23.8' scribed C1/4 S3 BT.
 The bearings were based on the record bearings to the existing BT's.
 An aluminum washer stamped RLS 852 is nailed between the letters B and T on each new tree. All the BT's have LSM and BT signs attached.
 Painted 6" red bands around all the trees and painted the scribe blazes red.

This work was done September 21, 1993.

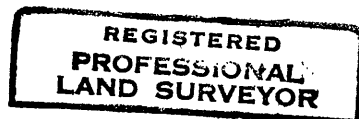

David L. Haddock

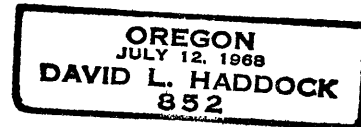

Office of Surveyor County of Grant
 State of Oregon, I hereby certify that the within instrument was filed
 in this office for record on the 16th day of March, 1994.
Robert D. Boyett by _____
 (COUNTY OFFICIAL) (DEPUTY)