


# CORNER RESTORATION

CORNER Angle Point TWP 8 S. RANGE 28 E.

ORIGINAL SURVEY BY: Aaron F. York; Retracement  
Henry Meldrum

CONTRACT NUMBER: 309; 380

CONTRACT DATE: March, 1879; March, 1881

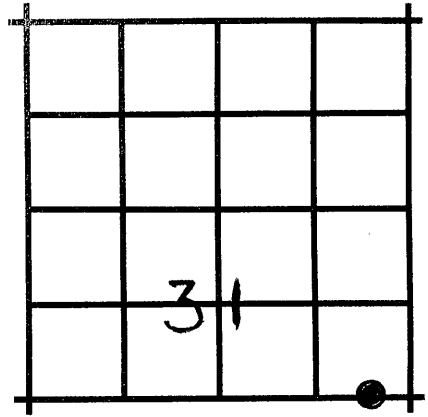

**ORIGINAL DESCRIPTION:** (York) East on true line 80.00 chains set stone 14x14x6 for corner to Sections 31 and 32. Raised mound of stone. (Note: Henry Meldrum found the South boundary of Twp. 8 S., R. 28 E. very irregular and established new corners to subdivide T. 8 S., R. 28 E. from. However, he did not change the alignment of standard parallel.) Retracement by Henry Meldrum: S. 88° 24' W. on South boundary Section 32; 80.00 chains set basalt stone 14x12x8 in mound of stone for corner to sections 31 and 32. S. 87° 29' W. on South boundary Section 31, 11.41 chains found old corner to Sections 31 and 32.

**RESTORATION BY, STAMP AND DATE:**

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Robert D. Baggett*

OREGON  
JULY 12, 1963  
ROBERT D. BAGETT  
598

Bob Bagett  
Chuck Ledford, Jr.

June 5, 1985

Grant County Surveyor

**EVIDENCE FOUND:** Found stone 12x12x6 1/2 foot South of a East-West fence line, under a rock jack, marked  $\frac{8}{28}$  with 5 notches on East edge and 1 notch on West edge. Set by Aaron York. This monument is an angle point on the standard parallel.

RECEIVED AND  
FILED

JUN 19 1985

See Grant County Record Map of Survey No. 863

OFFICE OF COUNTY SURVEYOR

*Robert D. Baggett*

Attest: *Cassie Veigt Co. clk.*

**DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:**

Show how trees are scribed and basis of bearings, including compass var.

I replaced marked stone with a 1 1/2"x30" iron pipe with attached brass cap set 30" in the ground with cap marked as shown:

From which I set the following reference points:

- A 5/8" x 30" iron pin bears S. 43° E., 20.00 feet with attached yellow plastic cap marked BGA Survey Marker.
- A 5/8" x 30" iron pin bears S. 48° W., 20.00 feet with attached yellow plastic cap marked BGA Survey Marker.

Buried original stone 1 foot South of pipe in bottom of hole.

Used magnetic compass with 20° E. var. and steel tape.

**MONUMENT MARKED**

