


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

This corner was originally set by F.W. Campbell under Contract No. 380 dated March 19, 1881. The notes state that a marked stone 18x18" was set and a mound of stone was raised.

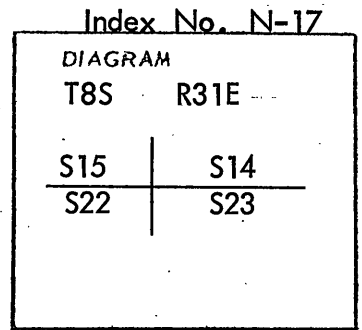

No record of subsequent remonumentation found in County Records .

Description of corner evidence found:

No evidence of the original corner location was found. Corner was re-established by double proportion measure.

Description of monument and accessories established to perpetuate the original location of this corner

At the corner position a 2 inch by 30 inch iron pipe, with brass cap marked as shown, was set 20 inches in the ground and surrounded with a mound of stones to the cap.

Set steel fence posts North and East of the corner and attached signs 54-2 and 54-4

Established 4 new BT's:

A 14" Pine bears N34°W 22.0 feet scribed T8S R31E S15 BT

A 6" Juniper bears N72°E 35.9 feet scribed T8S R31E S14 BT

A 9" Juniper bears S73°E 58.4 feet scribed T8S R31E S23 BT

A 7" Juniper bears S64½°W 56.1 feet scribed T8S R31E S22 BT

New BT's have a lower blaze scribed BT with brass washer stamped PLS 1106 nailed flush.

Attached signs 54-3 and 54-4 to all BT's and painted red ring around the trees above the upper blaze.

Used steel tape and magnetic compass with 19½° east declination. Measured to center of Bts.

See map of survey


This corner set November 8, 1979

Witnesses: D. Kaufman, PLS
B. English
D. Bartleson

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

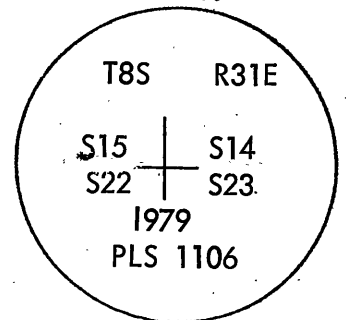

Office of County Surveyor County of Grant
State of Oregon, I hereby certify that the within Instrument was filed in this office
for record on the 9 day of Jan 1980
Robert D. Beatty by _____
(COUNTY OFFICIAL) (DEPUTY)