


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. E-13

History of original corner establishment:

The original corner was established by Aaron F. York under G.L.O. contract 309, dated July 12, 1879. His record reads.

Set stone 16x12x⁶ for Cor. to Secs. 3.4.9. and 10. Raised stone mound at corner.

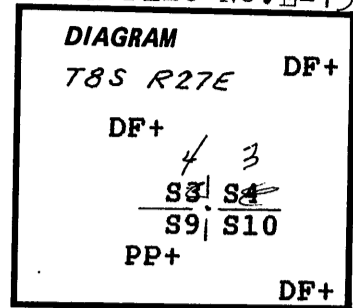


set BT +, record BT x
 PP=Ponderosa Pine
 J =Juniper
 DF=Douglas Fir

Description of corner evidence found:

Found stone broken in two pieces. Reassembled stone is 16x10x4 with 5 notches on face. Stone was in small mound.

Description of monument and accessories | established to perpetuate the original location of this corner:

Set a 2" I.D. galvanized iron pipe 30" long with 2 1/2" brass cap stamped:
 Set pipe 26" into the ground and buried the original stone along side.

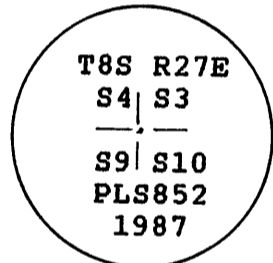

Placed a 3' diameter collar of stone around the monument and set a steel fence post 5' north of the monument with Forest Service Land Survey Monument and Property Boundary signs attached.

Scribed T8S R27E S3 BT on a 16" Douglas Fir which bears N32°29'E, 47.9'. Scribed T8S R27E S4 BT on a 20" Douglas Fir which bears N39°16'W, 27.1'. Scribed T8S R27E S9 BT on a 27" Ponderosa Pine which bears S62°09'W, 17.3'. Scribed T8S R27E S10 BT on a 10" Douglas Fir which bears S50°50'E, 39.0'. The bearings are true. Each scribe is in a 36" blaze. Nailed an aluminum washer stamped RLS 852 between the letters B and T on each tree. Painted a 6" red band around new bearing trees. Attached Forest Service Land Survey Monument and Bearing Tree signs.

I certify the above corner point was perpetuated as hereon described on August 13, 1987.

**REGISTERED
 PROFESSIONAL
 LAND SURVEYOR**

David L. Haddock

**OREGON
 JULY 12, 1968
 DAVID L. HADDOCK
 852**

Office of... Survey County of... Grant
 State of... Oregon I hereby certify that the within instrument was filed in this office
 for record on the 13 day of Oct 1987
Robert D. Baggett by
 (COUNTY OFFICIAL) (DEPUTY)