


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. G-13

History of original corner establishment:

The original corner was established by Aaron York under G.L.O. contract 309, dated July 12, 1879. His record reads:

Set Stone 16x12x6 for 1/4 Sec. Cor.
Raised Stone Mound at Cor.

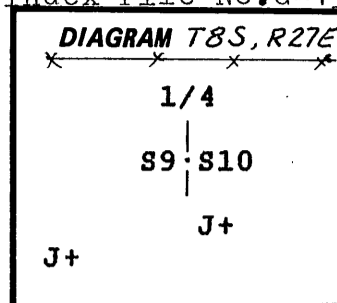


set BT +, record BT x
PP=Ponderosa Pine
J =Juniper
DF=Douglas Fir
x----x fence

Description of corner evidence found:

Found three stone mounds. One was 30' east of section line along an east west fence line. Another was 30' west along the fence line. The third was 30' east of the proportioned corner point. All were inspected for stones of record size or markings. None were found.

Description of monument and accessories established to perpetuate the original location of this corner:

Set a 2" I.D. galvanized iron pipe 30" long with 2 1/2" brass cap stamped:
Set pipe 14" into the ground.

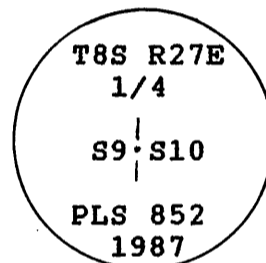

Placed a 3' diameter mound of stone around the monument and set a steel fence post 5'south of the monument with Forest Service Land Survey Monument and Property Boundary signs attached.

Scribed 1/4 S10 BT on 13" Juniper which bears S26°43'E, 76.2'
Scribed 1/4 S9 BT on a 24" Juniper which bears S60°42'W, 152.8'.
The bearings are true. Each scribe is in a 30" blaze. Nailed an aluminum washer, stamped RLS 852, between the letters B and T on each tree. Painted a 6" red band around the new bearing trees and attached Forest Service Land Survey Monument and Bearing Tree signs.

I certify the above corner point was proportioned as hereon described on August 12, 1987.

REGISTERED PROFESSIONAL LAND SURVEYOR

David L. Haddock

OREGON JULY 12, 1968 DAVID L. HADDOCK 852

Office of... Surveyor ... County of... Grant ...
State of... Oregon ... I hereby certify that the within instrument was filed in this office
for record on the... 27 day of... Oct ... 19... 87
Robert D. Baggett by ...
(COUNTY OFFICIAL) (DEPUTY)