


CORNER RESTORATION

CORNER: W1/4 Sec 12 TWP. 8S. RANGE 27E.

ORIGINAL SURVEY BY: Aaron F. York

CONTRACT NUMBER: 309

CONTRACT DATE: Nov. 18, 1878

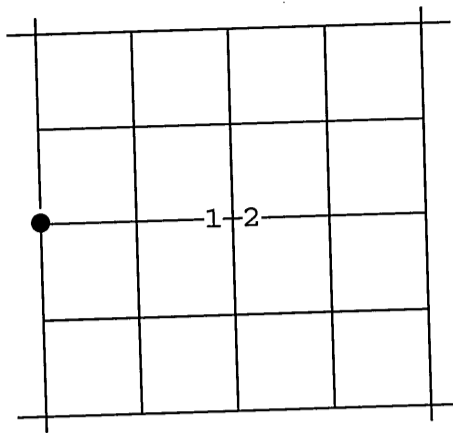

ORIGINAL DESCRIPTION: Set Stone 18x10x8 for 1/4 Sec. Cor. Raised Stone Mound at Cor.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
S.D. Follweiler
G.J. Russell
D.E. Mooney

RECEIVED AND FILED

June 4, 1996
OFFICE OF COUNTY SURVEYOR

Robert D. Bagett

ATTEST: *Steven D. Follweiler*

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598
RENEWAL DATE 12/31/97

April 10, 1996

See Record Map of Survey No. 1411

EVIDENCE FOUND: After a diligent search I found no evidence of the original corner. I declare this corner lost and establish its position at single proportionate measure between the found southwest corner of Section 12 and the accepted position of the northwest corner of Section 12.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:
Show how trees are scribed and basis of bearings, including compass var.

At the corner point: I set a 2½"x30" alum. pipe, 36" in the ground, with attached Bagett - Griffith and Blackman alum. cap marked as shown.
From which I SCRIBE NEW BEARING TREES:
A multi-trunk Juniper 7" diam., bears N56°E, 176.2 ft. marked 1/4 S12 BT.
A Juniper 11" diam., bears S06°E, 219.1 ft. marked 1/4 S12 BT.
A Pine 12" diam., bears S21°W, 234.5 ft. marked 1/4 S11 BT.
A Pine 12" diam., bears N45°W, 129.7 ft. marked 1/4 S11 BT.

MONUMENT MARKED
BAGETT-GRIFFITH
AND BLACKMAN

T8S R27E
¼
S11 | S12
1996
OPLS 598

Set a steel fence post 1 ft. North of cap. Used true bearings, (solar observation), and electronic distance measuring device, measuring to a 50d nail driven in the sidecenter at the root crown of the BT's. Attached BT tags to BT's.