


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established in 1881 by F.W. Campbell under general land office contract No. 380.
Surveyors general records state:
Set a basalt stone 20x15x3 and dug pits as per instructions for corner to secs. 1,2,11 & 12.
From which:
A pine 10" dia. bears N72E 25 lks.
" " 36" " " S30W 79 "

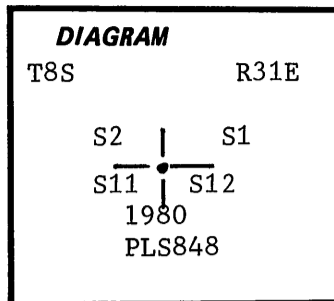

Description of corner evidence found:

Fd. broken stone 18"x12"x3" with broken 1/3 of stone set in the ground with 3 stones set around. Broken 2/3 of stone lying on the group of stones with 5 grooves on south face when fitted to place in ground.
From which:
A pine stump 42" dia bears S38W 53.0 ft. No marks visible, stump is burnt. No remains of other trees are found. Accepted the position of the stone described above as the sec. corner

Description of monument and accessories I established to perpetuate the original location of this corner:

Set 3"x30" galv iron pipe with 3" brass cap 24" in ground & placed original stone south along-side pipe. Stamped brass cap as shown in diagram.
From which:
A pine 15" dia bears N22W 45.0 ft. scribed T8S R31E S2 BT.
A " 10" " " N6E 19.7 ft. " " " 31. "
A steel posts bears S45E 5.9 ft. with bearing tree & warning signs.
A pine 11 " dia bears west 34.5 ft. scribed T8S R31E S11 BT.
Nailed brass washers stamped PLS848 & bearing tree signs to each tree, painted red band around each tree.
Bearing-mag compass 20"E Dec.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Douglas M. Ferguson
OREGON
JULY 12, 1968
DOUGLAS M. FERGUSON
848

Witnesses to above corner
D. Herburger
L. Wyllie

Office of..... *Sumner* County of..... *Grant*
State of..... *Oregon*, I hereby certify that the within instrument was filed in this office
for record on the..... *12* day of..... *Jan*, 19..... *81*.....
Robert D. Bayliff by
(COUNTY OFFICIAL) (DEPUTY)