


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Herman D. Gradon under GLO contract no. 499 dated March 11, 1884.

Surveyor General's records state:

Set a basalt stone 12x12x10 ins 8 ins in the ground for cor to secs 1 and 2 marked with 1 notch on the East and 5 notches on the West edges and raised a mound of stone alongside.

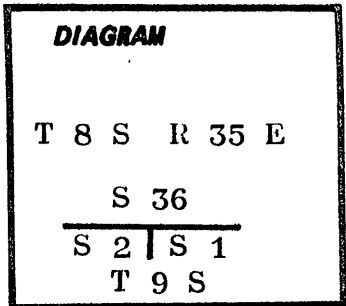

Description of corner evidence found:


None: corner has been destroyed by dredging operations.

(Found a 5/8"x30" rebar 0.61 feet West of re-established corner position determined by recorded GLO dist of 7.54 chains and on the South line of the SW quarter section 36 T 8 S R 35 E.)

Description of monument and accessories | established to perpetuate the original location of this corner:

Set a 2½ inch brass cap on a 2 inch iron pipe 27 ins in the ground with a 6 foot steel fence post alongside with a sign 54-4 attached.

Brass cap marked thus: T 8 S R 35 E

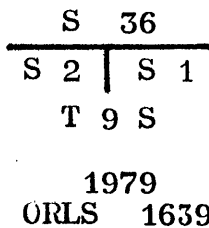

New bearing trees:

A pine 6 ins diam bears S. 32° W., 92.4 ft dist mkd T 9 S R 35 E S 2 BT
A 1" iron pipe 24" long 20 ins in the ground bears S. 42° E., 9.75 ft dist

No trees available within limits in section 1.

This BT has a sign 54-3 attached below a 6 inch band of red paint and has a brass washer marked LS 1639 nailed flush with BT blaze, and the pipe has a sign 54-5 properly marked and attached.

I hereby certify that this monument was properly re-established on June 13, 1979 witnessed by Tracy Labaree and Tom Fisk.

Office of... County Surveyor..... County of... ~~Grant~~ *William R Hanley*
 State of... Oregon....., I hereby certify that the within instrument was filed in this office
 for record on the 7th day of AUGUST, 1979
Robert O. Degett by.....
 (COUNTY OFFICIAL) (DEPUTY)

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R Hanley

OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639