


# SURVEYOR'S CERTIFICATE


I, Tyler B. Parsons, a registered Professional Land Surveyor in the State of Oregon, hereby certify that this plat and the notes hereon, or attached, are a correct representation of a survey performed during July/October, 1980, for the U.S. Forest Service, in accordance with the statutes of the State of Oregon and with the Articles of my contract.

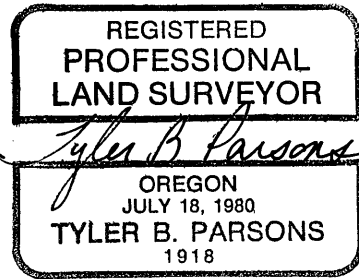

## NOTES

- Work performed by MSS Inc. for the U.S. Forest Service, Contract number 53-40H1-0-800 7N, Glade Cadastral Survey, Malheur National Forest.
- Original field notes for this contract are on file in the office of MSS Inc, 2720 NW Glenwood Dr., Corvallis OR.
- This survey covers a portion of Township 16 South, Range 33 East, Willamette Meridian originally surveyed in 1883 by Henry W. Cooke under Contract No. 488.
- Basis of Bearings is a solar observation near the North 1/16 Corner of Sections 17 and 18.
- Bearing Tree information given in feet was measured to the center of the tree one foot above the root crown. Information given in links was measured by the original survey or to the face of the scribe. All newly scribed Bearing Trees are marked in accordance with the Manual of Surveying Instructions, 1973, and have a 1" aluminum washer marked "PLS 1918" nailed to the center of the "BT" blaze.
- All corners not set from original evidence were set by double proportion (section corners) or single proportion (1/4 corners).
- 1 meter = 3.28038 feet.
- Legend:  
● - Found corner  
○ - Set corner  
----- National Forest boundary lines posted during this survey.  
( ) - Data of Record.

Magnetic Declination 20°

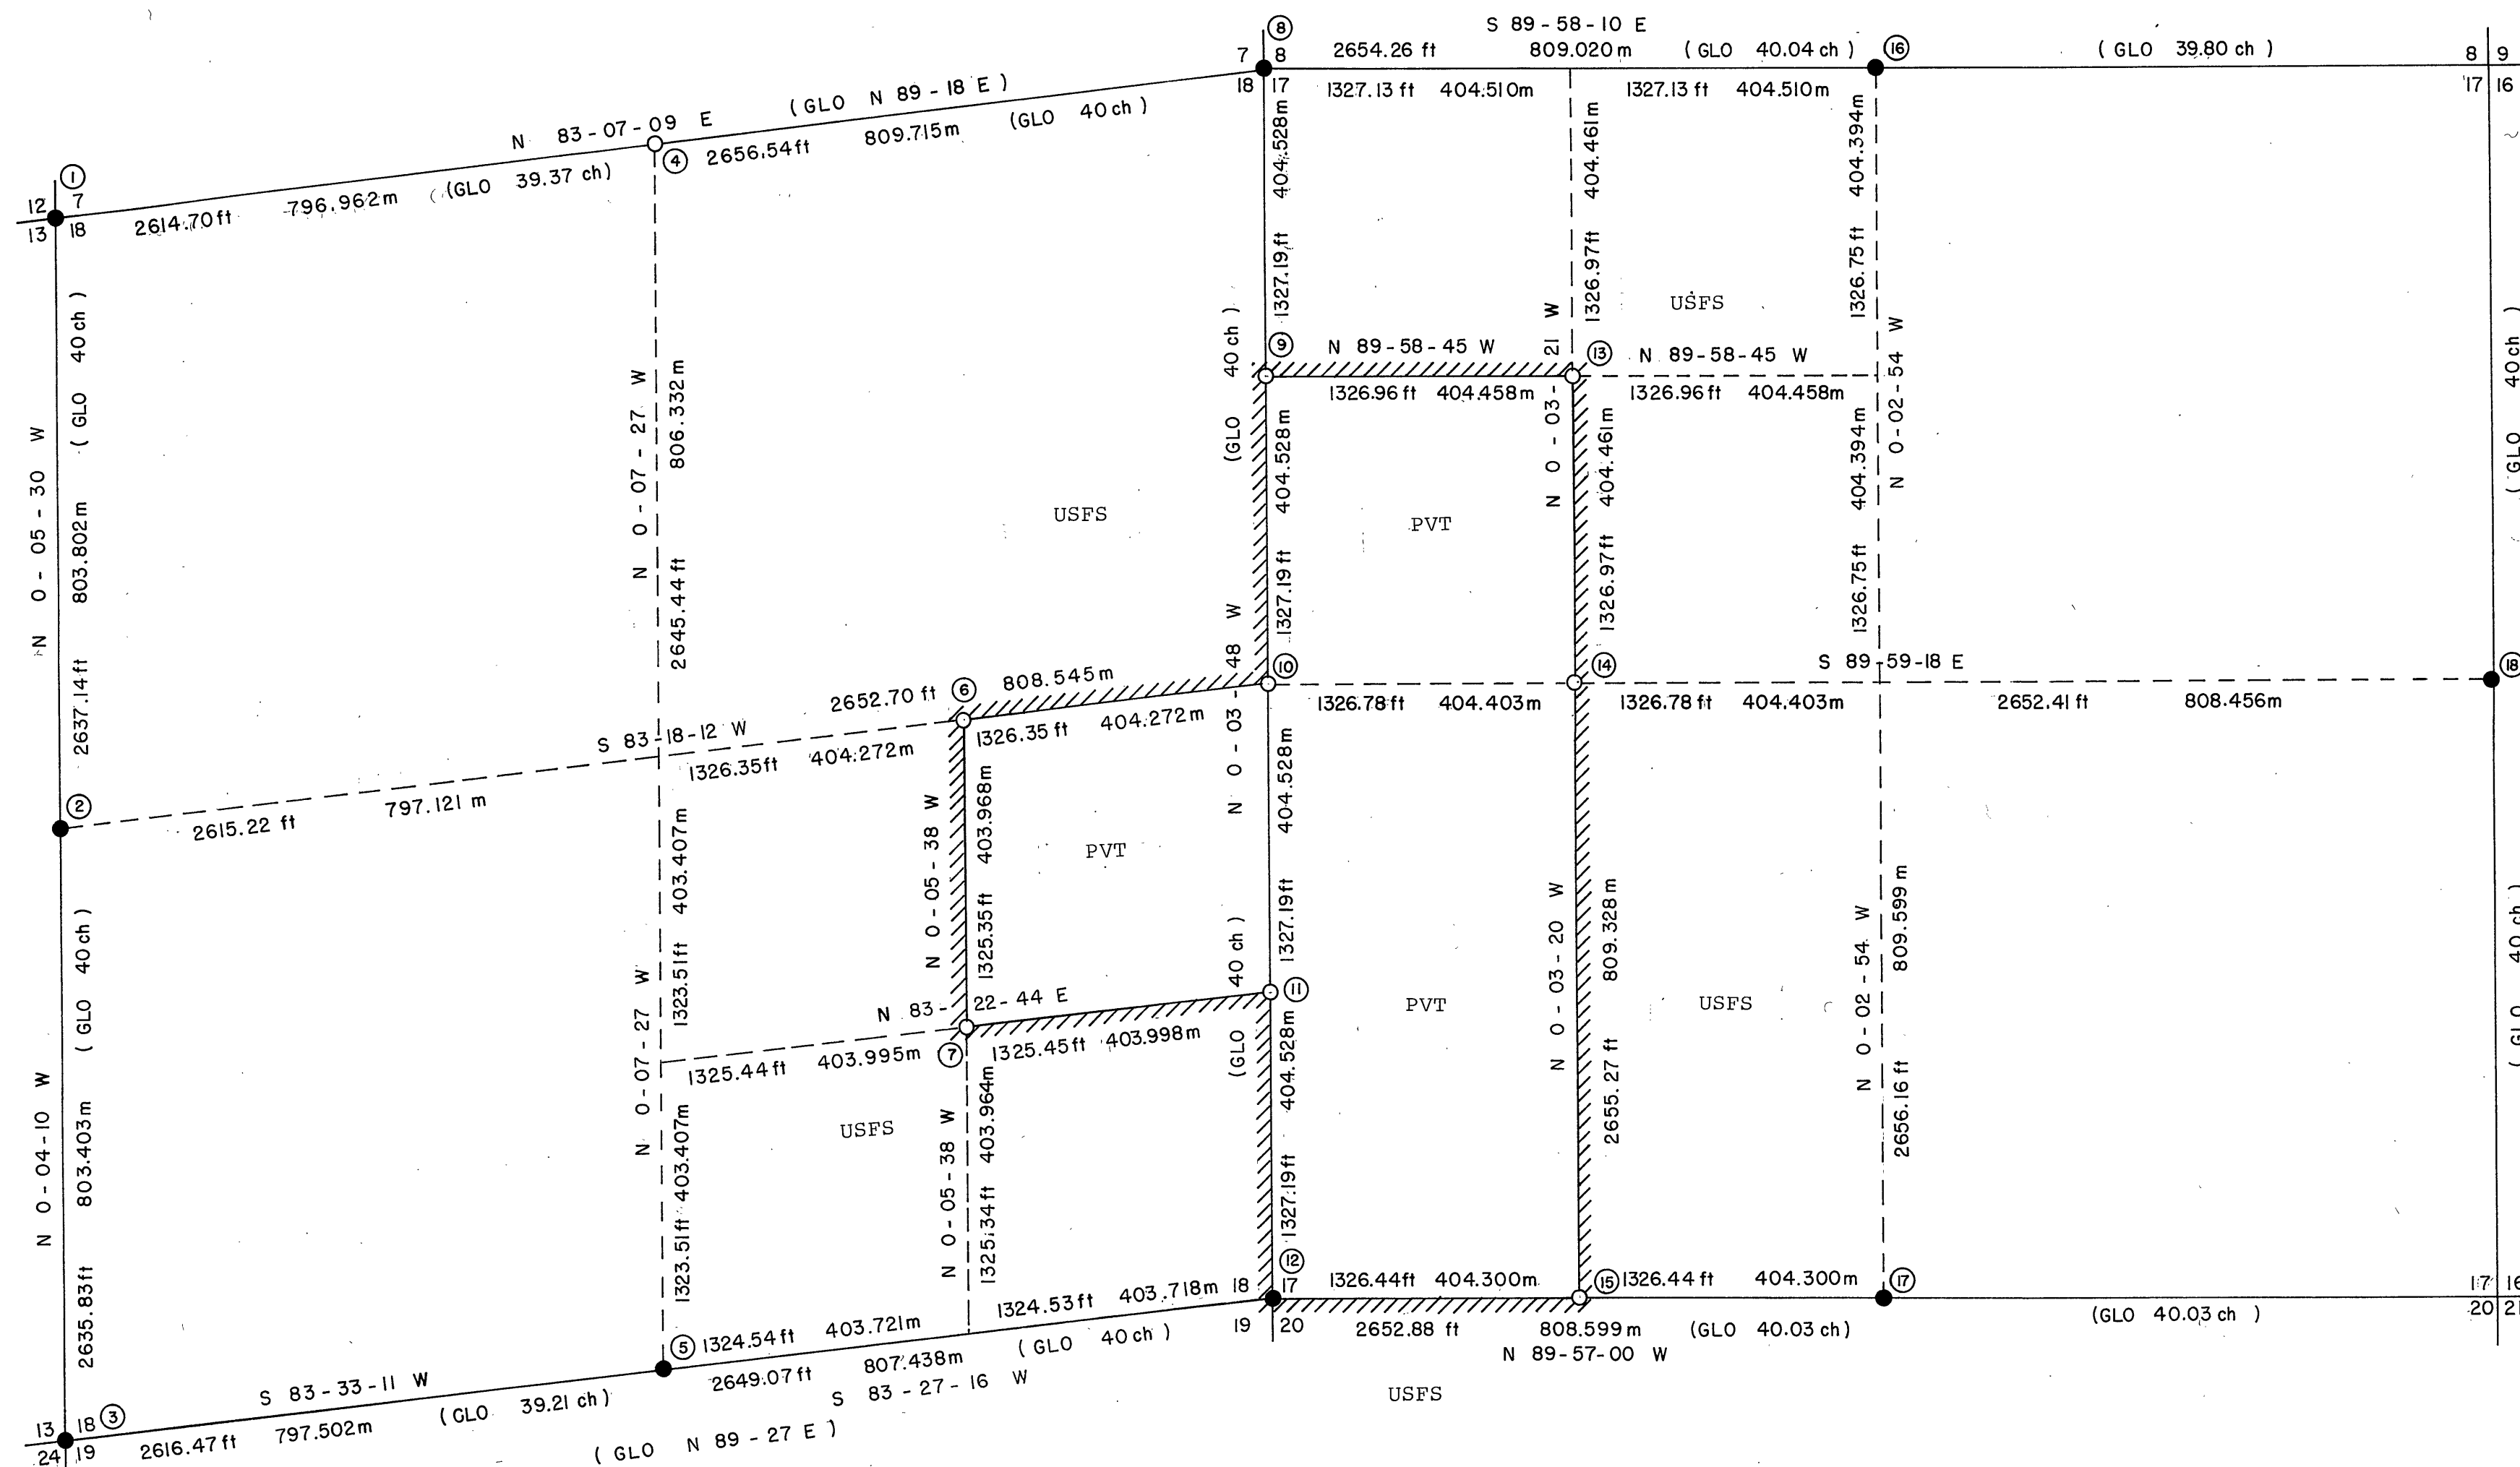

RECEIVED AND  
FILED

NOV 26 1980

OFFICE OF COUNTY SURVEYOR  
Attest: *[Signature]*

## 1 SW Corner Section 7

Found 2 1/2" Brass Cap on a 2"x30" galvanized iron pipe.  
BTS found  
9" Ponderosa pine, N60°E, 18.0 ft. T16S R33E S7 BT  
7" Lodgepole pine, N32°W, 73.4 ft. T16S R32E S12 BT  
11" Ponderosa pine, S34°W, 71.0 ft. T16S R32E S13 BT  
6" Ponderosa pine, S29°E, 21.5 ft. T16S R33E S18 BT

T16S  
R32E R33E  
S12 S7  
S13 S18  
1979  
OPLS 1805

## 2 W 1/16 Corner Section 18

Found 15"x17"x7" stone - no marks visible.  
BT found  
Ponderosa pine blowdown, N12°E, 33.0 ft. scribed 1/4 S  
Set 2 1/2" Brass Cap on 2"x30" galvanized iron pipe.  
Placed stone upside down to south of new monument.  
BTS set  
9" Lodgepole pine, N87°E, 14.4 ft. scribed 1/4 S 18 BT  
11" Lodgepole pine, N74°W, 38.7 ft. 1/4 S 13 BT

T16S  
R32E 1/4 R33E  
S13 S18  
PLS 1918  
1980

## 3 SW Corner Section 18

Found 2 1/2" Brass Cap on 2"x30" galvanized iron pipe.  
BTS found  
39" Ponderosa pine stump, S18°E, 11 lks. 3E S 19 BT  
14" Ponderosa pine windfall, N61°E, 59 lks. T16S R33E S18 BT  
26" Ponderosa pine, N17°W, 61 lks. Scribing visible.  
11" Lodgepole pine, S12°W, 26.3 ft. T16S R32E S24 BT  
9" Lodgepole pine, S13°E, 15.7 ft. T16S R33E S 19 BT  
6" Lodgepole pine, S57°E, 27.8 ft. T16S R33E S18 BT

T16S  
R32E R33E  
S13 S18  
S24 S19  
1979  
OPLS 1805

## 4 S 1/16 Corner Section 7

No evidence of original corner found - reset by proportion.  
Set 2 1/2" Brass Cap on 2"x30" galvanized iron pipe.  
BTS set  
25" Ponderosa pine, N21°W, 58.9 ft. Scribed 1/4 S 7 BT  
11" Ponderosa pine, S0°E, 50.2 ft. 1/4 S 18 BT

T16S R33E  
S 7  
S 18  
PLS 1918  
1980

## 5 S 1/16 Corner Section 18

Found 2 1/2" Brass Cap on 2"x30" galvanized iron pipe.  
BTS found  
18" Lodgepole pine, N18°E, 146 lks. Scribed 1/4 S 19  
16" Lodgepole pine, S66°E, 77 lks. 1/4 S 8 BT  
10" Lodgepole pine, S79°E, 70.1 ft. 1/4 S 19 BT

T16S  
R33E  
S 18  
S 19  
1979  
OPLS 1805

## 6 CE 1/16 Corner Section 18