

CORNER RESTORATION


CORNER: SW 1/16 Sec:13 TWP: 10S. RANGE:26E.

ORIGINAL SURVEY BY:

CONTRACT NUMBER:

CONTRACT DATE:

(Corner not
previously
established.)

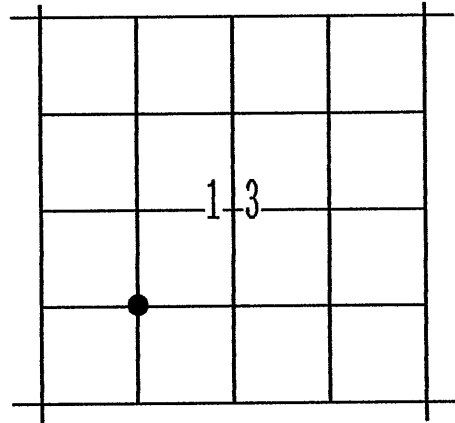

ORIGINAL DESCRIPTION: Corner not previously established.


RESTORATION BY, STAMP AND DATE:

R.D. Bagett
G.J. Russell
R.J. Lewis

RECEIVED AND
FILED

JUL 27 1994

STATE OF OREGON SURVEYOR
Attest: *Robert D. Bagett*



Robert D. Bagett
OREGON
JULY 12, 1993
ROBERT D. BAGETT
598

Renewal Date 12/31/94

May 12, 1994

EVIDENCE FOUND: None.

See Record Map of Survey No. 1320.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: I set a 5/8"x30" iron pin,
30" in the ground, with attached aluminum
cap marked as shown.

From which I SCRIBE NEW BEARING TREES:

A Douglas Fir 11"diam., bears S.31°E., 21.0 ft.,
marked 1/16 S13 BT.

A Douglas Fir 15"diam., bears S.43°W., 14.4 ft.,
marked 1/16 S13 BT.

MONUMENT MARKED

BGA
SURVEY MARKER
SW 1/16

S13
1994
OPLS 598

Raised a mound of stone 2 ft. base around cap. Used mag. compass with 20°E
var. and a steel tape, measuring to a 50d nail driven in the sidecenter at
the root crown of the BT's. Attached BT tags to BT's.