

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Original corner established by: E.A. Thatcher, Deputy Surveyor, under Contract No.325, dated June 4, 1879.

Surveyor General Record States: Set stone 13x9x7 inches, for 1/4 section corner raised stone mound at corner.


Retracement by: Aaron F. York, under Contract No.394, dated May 25, 1881.

Record states: I find 1/4 section corner a stone 12x8x6 inches in a stone mound.

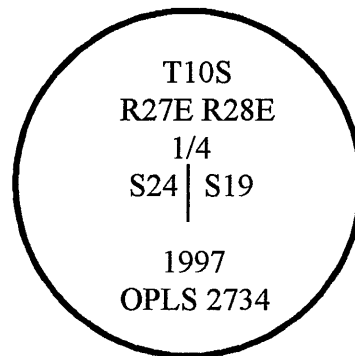

Description of corner evidence found:

None, this corner stone is probably in a fence rock jack.

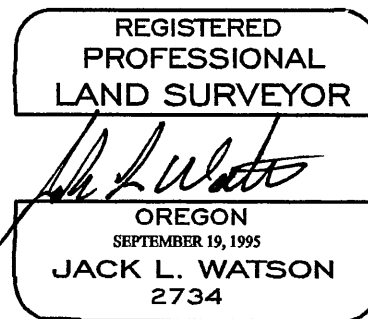

See Record Map of Survey No. 1449.

Description of monument and accessories set at corner location:

At single proportionate position I set a 2 1/2"x30" aluminum pipe with attached 2 1/2" aluminum cap, 28 inches in the ground, surrounded by a mound of stone. The cap is stamped as shown in the diagram.

From which I set new reference monuments:

A 5/8"x30" iron pin bears N50°E, 15.64 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.

A 5/8"x30" iron pin bears S43°E, 19.35 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.

A 5/8"x30" iron pin bears S50°W, 26.11 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.

A 5/8"x30" iron pin bears N45°W, 24.81 feet, with attached red plastic cap marked CORNERSTONE SURVEYING INC.

I used a steel tape and magnetic compass, with 20° E. declination, to tie references.

Date: August 14, 1997

Office of Surveyor County of Grant
State of Oregon, I hereby certify that the within instrument was filed in this office
for record on the 17 day of Sept, 1997.
Robert D. Beyer by _____
(COUNTY OFFICIAL) (DEPUTY)