

CORNER


RESTORATION

CORNER: N1/16 Sec 13,14 TWP. 10S. RANGE 29E.

ORIGINAL SURVEY BY: Corner

CONTRACT NUMBER: Not Previously

CONTRACT DATE: Established

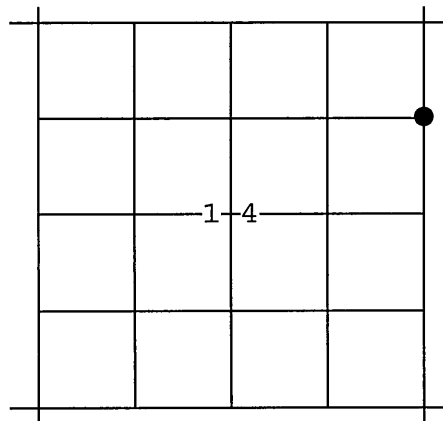

ORIGINAL DESCRIPTION: None

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
S.D. Follweiler
M.J. Dunham

RECEIVED AND
FILED

NOV. 8, 1996
OFFICE OF COUNTY SURVEYOR

Robert D. Bagett
ATTEST: *James Russell*

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

RENEWAL DATE 12/31/97

October 10, 1996

EVIDENCE FOUND: None

See Record Map of Survey No. 1429.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.


At the corner point: I set a 2½"x30" aluminum pipe,
26" in the ground, with attached Bagett - Griffith & Blackman
alum. cap marked as shown.

From which I SCRIBE NEW BEARING TREES:

A Ponderosa Pine 10"diam., bears S37°E, 24.2 ft.
marked N1/16 S13 BT.

A Douglas Fir 23"diam., bears S73°W, 32.4 ft.
marked N1/16 S14 BT.

MONUMENT MARKED

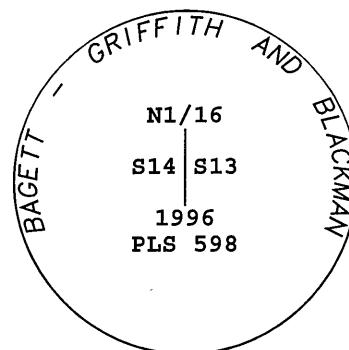

Raised a mound of stone 2 ft. base to top of cap. Used mag. compass with
20°E var. and a steel tape, measuring to a 50d nail driven in the
sidecenter at the root crown of the BT's. Attached BT tags to BT's.