

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:


Corner was established by Rufus S. Moore, US Deputy Surveyor, during the original survey Contract No. 382 dated March, 1881.

Set a basalt stone 12x8x8 for 1/4 sec. cor. from which a

- Pine 22 ins. diam., bears N40°W, (33.66') 51 lks. dist.
- Pine 36 ins. diam., bears S20°E, (29.70') 45 lks. dist.

DIAGRAM

T10S R31E

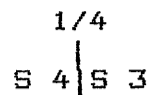

1989
PLS 699

Description of corner evidence found:

Found the bearing trees to not be at record distance. Commenced a search for the stone between the two bearing trees. Only one was found that was 13x8x7 firmly set in the ground and was accepted as the corner. No markings was found on any stone.

28" Ponderosa pine (Good Condition)(Blaze Opened by Others)(1881 BT) bears N39°W, 44.2 feet. There was no stones at all at call distance.

35" Ponderosa pine (Good Condition)(Scribing Visible)(1881 BT) bears S53°30'E, 114.8 feet. Checked several scenarios, but finally chose the only rock of appropriate size.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 2"x30" aluminum pipe with a 2 1/2" aluminum cap, marked as shown in the diagram, 22" in the ground to solid rock, replacing the rock which is turned upside down and buried on the north side of the monument. Built a mound of rock to be 40" in diameter by 8" high around the monument, from which new BTs are:

- 7" Douglas-fir bears S24°W, 32.1 feet scribed 1/4 S4 BT
- 7" Juniper bears N58°15'E, 28.0 feet scribed 1/4 S3 BT

Attached BT and Attention signs to and painted a red band around each BT. Bearings were turned from the control traverse with a theodolite, basis of bearing being the bearing between corners G-13 and N-13 as shown on Grant County Map of Survey No. 634, to stamped brass washers nailed in the scribed red-painted blazes. Distances were measured from a 60d spike, with an aluminum washer stamped PLS 699, which was driven into the side of each BT approximately one foot above the ground.

Set a steel fence post 5 feet S of the corner with an Attention sign attached. The monument is not a National Forest property corner.

I, Leland L. Myers, P.O. Box 98, Sumpter, OR 97877, do hereby certify that on August 7, 1989, I monumented the corner as herein described.

FILED

IN THE OFFICE OF THE Grant COUNTY SURVEYOR
THIS 26 DAY OF July, 1990

Robert D. Sayre
Grant County Surveyor

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Leland L. Myers

OREGON
JULY 9, 1965
LELAND LEE MYERS
699