


# CORNER RESTORATION

CORNER: W1/4 Sec 21 TWP. 10S. RANGE 31E.

ORIGINAL SURVEY BY: Rufus S. Moore

CONTRACT NUMBER: 382

CONTRACT DATE: March 23, 1881

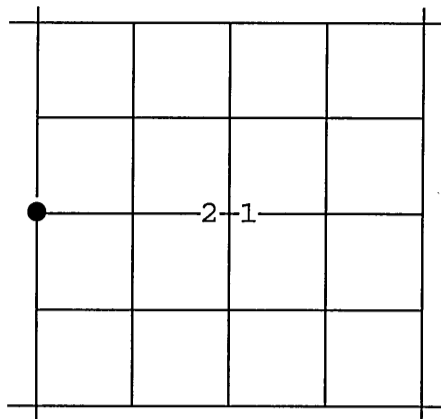

**ORIGINAL DESCRIPTION:** Set a basalt stone 15x7x5 for 1/4 sec. cor, dug pits.

**RESTORATION BY, STAMP AND DATE:**

R.D. Bagett  
S.D. Follweiler  
G.J. Russell

RECEIVED AND  
FILED

*JAN 18, 1996*  
OFFICE OF COUNTY SURVEYOR

*Robert D. Bagett*

ATTEST: *Steven D. Follweiler*

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Robert D. Bagett*  
**OREGON**  
JULY 12, 1963  
**ROBERT D. BAGETT**  
598

RENEWAL DATE 12/31/97

November 22, 1995

**EVIDENCE FOUND:** I did not find the original 1/4 corner stone or any evidence of its position. After a diligent search without finding the corner, I am convinced it has been destroyed. I therefore set the corner at single proportionate measure between the found NW and SW corners of Sec. 21.

Corner is 40' west of fence running North and South.

See Record Map of Survey No. 1392.

**DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:**  
Show how trees are scribed and basis of bearings, including compass var.

At the corner point: I set a 2 1/2"x30" galv. iron pipe, 26" in the ground, with attached Bagett - Griffith & Blackman brass cap marked as shown.

From which I SCRIBE NEW BEARING TREES:

- A Douglas Fir 9"diam., bears N37°E, 34.8 ft. marked 1/4S21 BT.
- A Ponderosa Pine 13"diam., bears S45°E, 95.6 ft. marked 1/4S21 BT.
- A Douglas Fir 11"diam., bears S61°W, 98.4 ft. marked 1/4S20 BT.
- A Douglas Fir 13"diam., bears N31°W, 34.6 ft. marked 1/4S20 BT.

**MONUMENT MARKED**

BAGETT - GRIFFITH & BLACKMAN

T10S R31E

1/4  
S20 | S21

1995  
OPLS 598

Raised a mound of stone 2 ft. base to top of cap. Used mag. compass with 20°E var. and a steel tape, measuring to a 50d nail driven in the sidecenter at the root crown of the BT's. Attached BT tags to BT's.