

CORNER


RESTORATION

CORNER: S1/4 Sec 21 TWP. 10S. RANGE 31E.

ORIGINAL SURVEY BY: Rufus S. Moore

CONTRACT NUMBER: 382

CONTRACT DATE: March 23, 1881

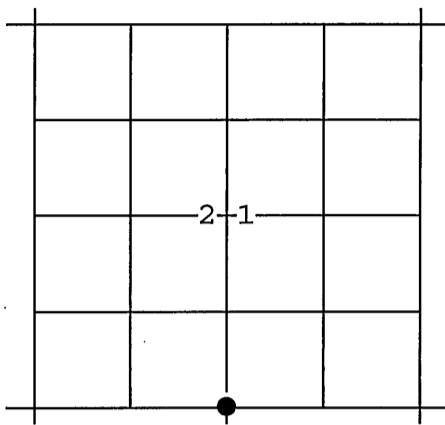

ORIGINAL DESCRIPTION: Set a basalt stone 14x7x7 and raised a mound for 1/4 sec. cor.

RESTORATION BY, STAMP AND DATE:

R.D. Bagett
S.D. Follweiler
G.J. Russell

RECEIVED AND
FILED

Jan. 18, 1996
OFFICE OF COUNTY SURVEYOR

Robert D. Bagett

ATTEST: *Steven D. Follweiler*

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

RENEWAL DATE 12/31/97

November 22, 1995

EVIDENCE FOUND: I did not find the original 1/4 corner stone or any evidence of its position. After a diligent search without finding the corner, I am convinced it has been destroyed. I therefore set the corner at single proportionate measure between the found SE and SW corners of Sec. 21.

See Record Map of Survey No. 1392.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the corner point: I set a 2 1/2"x30" galv. iron pipe, 30" in the ground, with attached Bagett - Griffith & Blackman brass cap marked as shown.

From which I SCRIBE NEW BEARING TREES:

A Western Larch 12"diam., bears N67°E, 17.7 ft. marked 1/4S21 BT.

A Western Larch 13"diam., bears S66°E, 10.6 ft. marked 1/4S28 BT.

A White Fir 9"diam., bears S49°W, 31.8 ft. marked 1/4S28 BT.

A White Fir 10"diam., bears N21°W, 81.7 ft. marked 1/4S21 BT.

MONUMENT MARKED

BAGETT - GRIFFITH
& BLACKMAN

T10S R31E
S21

1/4 ———
S28
1995
OPLS 598

Raised a mound of stone 3 ft. base to top of cap. Used mag. compass with 20°E var. and a steel tape, measuring to a 50d nail driven in the sidecenter at the root crown of the BT's. Attached BT tags to BT's.