

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: *

The original corner was set in 1881 by Robb and Gradon under Contract No. 383, dated March 26, 1881.

The original notes state:

N89°44'E on true line between Secs 6 & 7

40.83 Set post for 1/4 Sec Cor from which

A pine 40 in dia bears N 15° E, 43 lks dist

A Tamarack 4 in dia bears S 12° W, 30 lks dist

DIAGRAM

T10S R32E

S6

1/4---

S7

Description of corner evidence found:

Found no evidence of the original post.

A 40"+/- P.Pine snag, very badly burned out, with ax marks on the West side, bears N 15° E, 43 lks to the estimated position of the face. This tree fits well with the section corners on either side and I accept it as the original BT. Other large trees in the area show no marks.

Description of monument and accessories I establish to perpetuate the original location of this corner:

I reestablish the corner position at record distance and direction from the original bearing tree. Set a 2"x28" aluminum monument 22" in the ground.

I establish new bearing trees:

An 11" Fir bears N 83° E, 16.6 ft, scribed 1/4S6BT.

A 13" P.Pine bears S 16° E, 11.2 ft, scribed 1/4S7BT.

T10S R32E

S6

1/4---

S7

PLS1918

1988

New BTs have 3/4" brass washers marked PLS1918 attached to the BT blaze, faces and bands painted with red tree marking paint, and BT tags and Attention or Land Survey Monument signs. A steel fence post with Attention or Land Survey Monument sign is driven approximately 3-5 feet from the corner.

Sun Cadastral Survey, Cont No. 53-04H1-7-4011


Field Book: 4-39 & 6-16

Work accomplished: 9/1/88

Witnesses: Tyler Parsons, Sharon Parsons
Louise Parsons, Douglas Parsons

Job No.: 87221

PARSONS SURVEYING
1915 S.E. Stone Street
Corvallis, OR 97333
(503) 752-7515

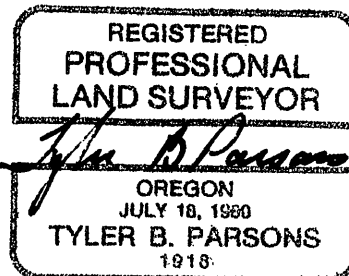

Office of COUNTY SURVEYOR County of GRANT
State of OREGON, I hereby certify that the within instrument was filed in this office
for record on the 7th day of Feb, 1989

[Signature] by _____
(COUNTY OFFICIAL) (DEPUTY)