

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

SEE RECORD
SURVEY NO. 1098

INDEX NO. C-5

History of original corner establishment:


Corner originally established by Robb and Gradon under Contract No. 383 and dated March 26, 1881.

Original notes state:

Set stone 16 x 8 x 5 ins for 1/4 Sec Cor. from which:

A fir 14 in dia bears N60°E, 29 lks dist.

A pine 36 in dia bears S75°W, 60 lks dist.

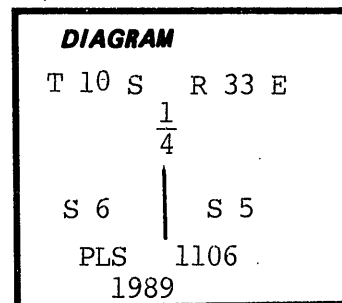

Description of corner evidence found:

Found a 18 x 9 x 6" basalt stone marked 1/4, upright in stone mound from which:

A 28" sick douglas fir brs N58½°E, 19.2' with healed blaze.

A 33" ponderosa pine brs S75°W, 40.2' with scribing visible on partially healed blaze.

Description of monument and accessories | established to perpetuate the original location of this corner:

At position of found stone...

Set 2½" x 30" aluminum pipe with standard 3¼" USDA aluminum cap 24" in ground & surrounded with mound of earth & stone. Cap marked as shown in corner diagram. Buried corner stone in new mound.


New bearing tree established:

A 18" ponderosa pine brs S60 3/4°E, 72.9' scribed 1/4 S 5 BT.

New bearing tree has a brass washer stamped PLS 1106 nailed to face of blaze. Attached sign 54-3 & 54-4 to each BT & painted face of blaze & 6" red band around each BT. Set steel fence post North of corner and attached sign 54-4.

Compass declination 18° East.

I hereby certify that the above corner was properly remonumented by me to U.S.F.S. standards and witnessed by Bill Quaempts on July 28, 1989.

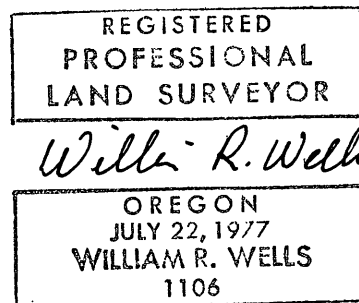

Office of... County Surveyor... County of... Grant...
State of... Oregon... I hereby certify that the within instrument was filed in this office
for record on the 29 day of Mar, 1990
Robert D. Rogers by (COUNTY OFFICIAL) (DEPUTY)