


CORNER RESTORATION

CORNER SW Sec. Cor TWP 10 S. RANGE 33 E

ORIGINAL SURVEY BY: ROBB & GRADON

CONTRACT NUMBER: 383

CONTRACT DATE: March 26, 1881

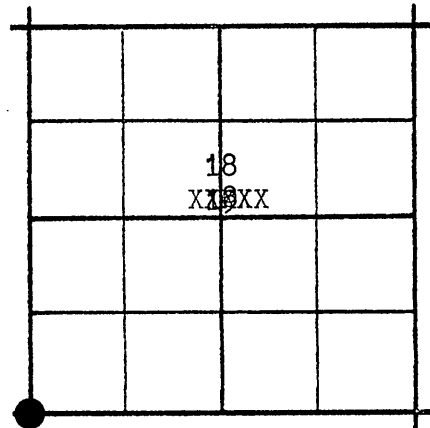

ORIGINAL DESCRIPTION:

Set stone 14 x 10 x 6 and raised mound for corner to Sec's. 13, 18, 19 & 24.

RESTORATION BY, STAMP AND DATE: **RECEIVED AND**

OREGON EAST ENGINEERING, INC.
P.O. BOX 1091
MT. VERNON, OREGON



FILED

MAY 23 1979

Restored in May, 1978

JOHN LIVEIRA, County Clerk

By Caree Vaigt Deputy

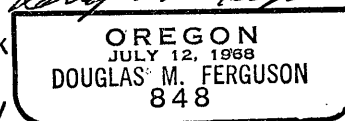

EVIDENCE FOUND:

Original corner monument was not found, as a ditch was constructed through it's position. An un-recorded 30" ϕ Ponderosa Pine had been blazed and faces the corner position. The blazing appears to be 50 to 100 years old. The corner was positioned using topography calls as follows: Foot of hill called at 79.98 ch. This is quite pronounced therefore the N-S position is located from that point. This is confirmed by a call to the Middle Fork River at 2.82 ch. Camp Creek is called at 11.00 ch. to the east. The channel has not moved therefore this call is used to position the corner E & W.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

Set a 2 $\frac{1}{2}$ " x 30" pipe with brass cap marked as shown, in the ground and raised up a mound of stones around the monument, from which:

An 8" P. Pine bears N 32 E - 13.5 ft.

scribed " T10S R33E S18 BT "

An 12" P. Pine bears S 62 E - 24.1 ft.

scribed " T10S R33E S19 BT "

A 6" P. Pine bears S 24 W - 79.7 ft.

scribed " T10S R32E S24 BT "

Attached U.S.F.S. Bearing Tree signs to the BT's.

Complete and File with Office of the Grant
County Surveyor, Grant County, Oregon,
Courthouse, Canyon City, Oregon 97820

Compass Var. 20 E.

MONUMENT MARKED

