

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

*

The original corner was established by Herman Gradon in 1881 under Contract No. 383.

The original notes state:

S89°46'E on true line between Sec 18 & 19

40.20 Set stone 14x12x7 in stone mound for 1/4 sec cor.

DIAGRAM

T10S R33E

S18

1/4---

S19

Description of corner evidence found:

Found no evidence of the original corner.

Description of monument and accessories I establish to perpetuate the original location of this corner:

Reestablish this corner by single proportion. Set a 2-1/2x30" aluminum monument 20" in the ground in a mound of stone.

A 1-1/2" aluminum cap on rebar bears S3°45'W 8.17ft marked RM 1/4S19 PLS1918.

A 1-1/2" aluminum cap on rebar bears N3°45'E 8.09ft marked RM 1/4S18 PLS1918.

T10S R33E

S18

1/4---

S19

PLS1918

1989

Sun Cadastral Survey

Contract No.: 53-04H1-7-4011

Project No.: 8722LA


Field Book: 7-52

Work Accomplished: 5/12/89

Witnesses: Louise Parsons

New BTs have 3/4" brass washers marked PLS1918 attached to the BT blaze, faces and bands painted with red tree marking paint, and BT tags and Attention or Land Survey Monument signs. A steel fence post with Attention or Land Survey Monument sign is driven approximately 3-5 feet from the corner.

PARSONS SURVEYING
1915 S.E. Stone Street
Corvallis, OR 97333
(503) 752-7515

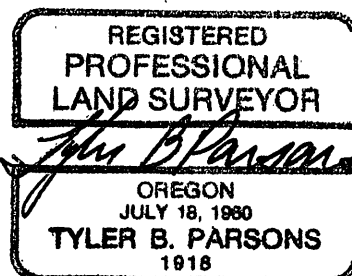

Office of COUNTY SURVEYOR

County of GRANT

State of OREGON

, I hereby certify that the within instrument was filed in this office for record on the 10 day of Aug, 1989

Robert D. Baggett

by

(COUNTY OFFICIAL)

(DEPUTY)