

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established in 1881 by Robb and Gradon under General Land Office Contract No. 383.

Surveyor General's records state:

Set post for corner to Sections 14, 15, 22 & 23.

From which:

A fir 30" dia. bears N 40° W, 14 lks. dist.

A tamarack 10" dia. bears N 45° E, 72 lks. dist.

A tamarack 14" dia. bears N 45° E, 49 lks. dist.

A tamarack 10" dia. bears S 40° W, 23 lks. dist.

DIAGRAM

T10S	R33E
S 15	S 14
S 22	S 23
1980	
PLS 848	

Description of corner evidence found:

Found a fir 36" dia., live, blaze and chaining notch visible, bears N 70° W, 9.2 ft. from a point. Found a tamarack 10" dia., dead and leaning over, scribing visible - S 14 "Notch" and T, bears N 43° E, 49.0 ft. from a point. Found a tamarack 18" dia., dead and down, bears S 39° E, approx. 33 ft. from a point. Said point is accepted as corner position.

Description of monument and accessories I established to perpetuate the

original location of this corner:

Set 30"x3" aluminum pipe with 3 1/2" aluminum cap marked as shown 25" in the ground.

From which:

A fir 9" dia. bears N 42° E, 19.7 ft. scribed T10S, R33E, S 14 BT.



A fir 14" dia. bears S 27° E, 17.2 ft. scribed T10S, R33E, S 23 BT.

A fir 16" dia. bears S 43° W, 44.2 ft. scribed T10S, R33E, S 22 BT.

Nailed brass washers stamped PLS 848 and bearing tree signs to all bearing trees. Painted red band around all bearing trees.

Set steel fence post 4 ft. North from pipe with warning sign attached.

Witnesses to the above corner:

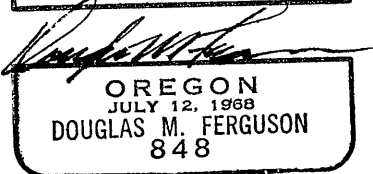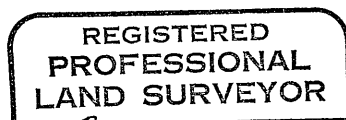

J. David Brinton

P. Negus

Office of..... Co. Surveyor..... County of..... Grant.....
State of..... Oregon....., I hereby certify that the within instrument was filed in this office
for record on the 22 day of Aug....., 1980
Robert D. Degott by.....
(COUNTY OFFICIAL) (DEPUTY)