

RECEIVED

FILED

MAR 16 1972

JOHN LIVEIRA, County Clerk

CORNER RESTORATION


By _____ Deputy

CORNER West $\frac{1}{4}$ Cor. Sec. 21 TWP 10 S., RANGE 33 E., W.M.

ORIGINAL SURVEY BY: Banford Robb & Herman Gradon

CONTRACT NUMBER: 383

CONTRACT DATE: March 26, 1881

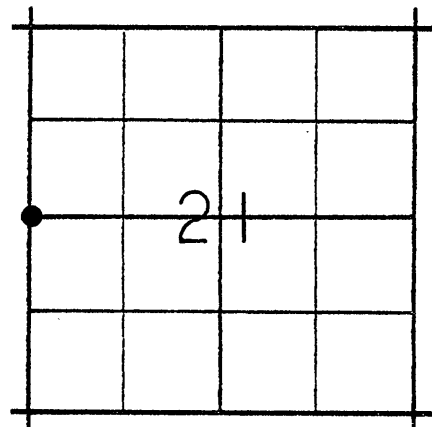

ORIGINAL DESCRIPTION:

North Bet. secs. 20 and 21.
Var. 20° East.

40.00 Set stone 14x14x8 in stone mound for $\frac{1}{4}$ sec cor
from which
A pine 30 in. dia., brs. S. 30° W., 59 lks. dist.

RESTORATION BY, STAMP AND DATE:

BAGETT, GRIFFITH & FERGUSON
170 S. DAYTON - PH. 575-1251
JOHN DAY, OREGON 97845

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

March 10, 1972

EVIDENCE FOUND: Unmarked stone in a mound of stone,
from which

The original BT, a pine 40 ins. diam., bears S. 35° W., 38.0 ft., to old
blaze which had been opened, visible scribing on the old blaze.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

At the unmarked stone, set a $1\frac{1}{2}$ "x30" iron pipe, 20 ins. in the ground
with brass cap marked as shown.

from which NEW BEARING TREES

MONUMENT MARKED

A pine, 7 ins. diam., bears N. 87° E., 18.4 ft., scribed
 $\frac{1}{4}$ S21 CS BT.

A pine 10 ins. diam., bears N. 12° W., 43.2 ft., scribed
 $\frac{1}{4}$ S20 CS BT.

Surround pipe with a mound of stone, 3 ft. base and
raise to top of pipe.

Compass bearings with 20° East. var., measurements to
new BTs are to the
Complete and File with Office of the Grant center of the tree.
County Surveyor, Grant County, Oregon,
Courthouse, Canyon City, Oregon 97820

