


CORNER RESTORATION

CORNER NW Sec. Cor TWP 10 S. RANGE 33 E.

ORIGINAL SURVEY BY: ROBB & GRADON

CONTRACT NUMBER: 383

CONTRACT DATE: March 26, 1881

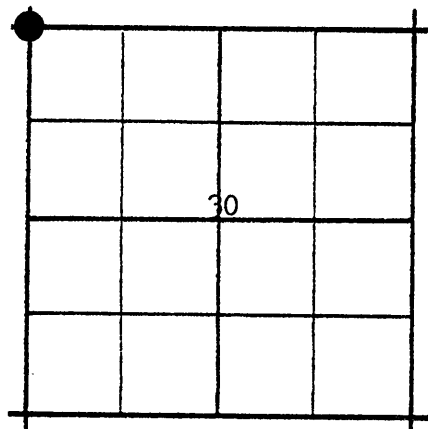

ORIGINAL DESCRIPTION:

Set stone 14 x 8 x 6 for corner to Sec's. 19, 24, 25 & 30.

RESTORATION BY, STAMP AND DATE:

OREGON EAST ENGINEERING, INC.
P.O. BOX 1091
MT. VERNON, OREGON

RECEIVED AND
FILED

MAY 23 1979

Restored in May, 1978.

JOHN LIVEIRA, County Clerk

By *Carol Vigt* Deputy

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 12, 1968
DOUGLAS M. FERGUSON
848

EVIDENCE FOUND:

Found the remains of a stone mound, original stone was not found. Also found a rotten Pine stump, with visible axe marks, bearing S 45 W - 33 ft. and a rotten, down Pine bears N 66 W - 74 ft. No marks or scribing found, however the position fits the original topography calls from the old channell of Camp Creek to the east and south. Also, the accepted position is in harmony with other found corners.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

Set a 2½" x 30" pipe with brass cap marked as shown, in the ground and raised up a mound of stones around the monument, from which:

A 28" Douglas Fir bears S 52 W - 50.6 ft.

scribed " T10S R32E S25 BT ".

A 14" Ponderosa Pine bears S 86 W - 52.0 ft.

scribed " T10S R32E S25 BT ".

Attached U.S.F.S. Bearing Tree signs to the BT's.

Compass Var. 20 E.

Complete and File with Office of the Grant
County Surveyor, Grant County, Oregon,
Courthouse, Canyon City, Oregon 97820

MONUMENT MARKED

