

50

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner established in 1881 by Robb and Gradon
under General Land Office Contract No. 383.
Surveyor General's records state:

Set stone 12"x10"x6" for 1/4 Section Corner
from which:

A pine 10" dia. bears N 50° E, 40 lks. dist.

A pine 24" dia. bears S 55° W, 24 lks. dist.

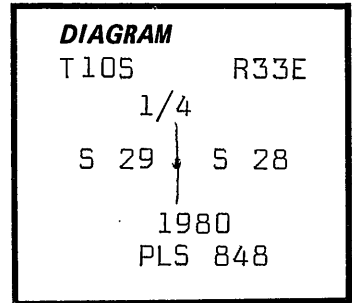

Description of corner evidence found:

Found pine 26" dia., "T" scribing visible, bears N 50° E, 26.0 ft. from
a point.

Found pine 30" dia., 1/4 scribing visible, bears S 55° W, 16.0 ft. from
a point.

Both trees are live and in good condition.

Accepted the point as the true location of the corner.

Description of monument and accessories | established to perpetuate the
original location of this corner:

Set 30"x3" aluminum pipe with 3 1/2" aluminum cap, marked as shown,
26" in the ground.

Because both original bearing trees are in good condition, no new
bearing trees are taken.

Witnesses to above corner:

D. Brinton

P. Negus

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Douglas M. Ferguson
OREGON
JULY 12, 1968
DOUGLAS M. FERGUSON
848

Office of... Co. Surveyor... County of... Grant...
Oregon
State of... , I hereby certify that the within instrument was filed in this office
for record on the... 30... day of... Aug... , 19... 80
Robert H. Deaton by _____
(COUNTY OFFICIAL) (DEPUTY)