


CORNER RESTORATION

SE corner
CORNER Sec. 20 TWP11 S RANGE 26 E

ORIGINAL SURVEY BY: Aaron F. York

CONTRACT NUMBER: 371

CONTRACT DATE: October 27, 1880

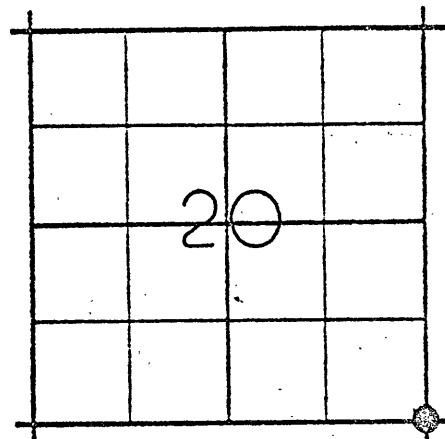

ORIGINAL DESCRIPTION:

North on line between Secs. 28 and 29.

80.00 set stone 18x16x4 for corner to Secs. 20, 21, 28 and 29.

Raised stone mound at corner.

RECEIVED AND
FILED

SEP 18 1979

JOHN LIVEIRA, County Clerk

By *Laurance* Deputy

RESTORATION BY, STAMP AND DATE:

D. I. Griffith
K. Leckenby

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett
OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

April 25, 1979

Grant County Surveyor.

EVIDENCE FOUND:

Found stone 18"x16"x3" marked with 4 and 2 grooves and set in a mound of stone.

See Map of Survey No. 571.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

Show how trees are scribed and basis of bearings, including compass var.

STANDARD NATIONAL PARK SERVICE
MONUMENT MARKED

I accept the position of the corner stone.

At the corner point: Set 2½"x30" aluminum pipe with National Park Service aluminum cap marked as shown. I buried the corner stone South and alongside the aluminum pipe and surrounded the pipe with a concrete collar and a mound of stone, from which I scribed NEW BEARING TREES:

A 6" Juniper bears N. 58° E., 89.6 ft. Mkd. T11SR26ES21CSBT.
An 8" Juniper bears S. 17° E., 53.0 ft. mkd. T11SR26ES28CSBT.
A 5" Juniper bears S. 30° W., 73.9 ft. mkd. T11SR26ES29CSBT.
A 7" Juniper bears N. 29° W., 118.9 ft. mkd. T11SR26ES20CSBT.
Complete and File with Office of the Grant

County Surveyor, Grant County, Oregon,
Courthouse, Canyon City, Oregon 97820

I used a magnetic compass with 20° East variation and steel tape, measuring to the center of the bearing trees.

